

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



Ambassador Inspections
 Brennan Smith
BrennanSmith2896@outlook.com
 Brennan Smith: 984-255-3633
 Robert Smith: 919-339-5633
 PO Box 337
 Bunn, NC 27508

Property Address	
Street:	939 Cheves Rd
City:	Zebulon
State:	NC
ZIP:	27597
Client Information	
Client Name:	[REDACTED]
Inspection Details	
Date of Inspection:	07/01/2026 15:30
Advertised number of bedrooms as stated in MLS or as stated in attached in sworn statement by owner or owner's representative:	3 bedrooms
Designed system size or number of bedrooms as stated in available local health department information in gallons per day:	Unknown. No permit available per the county.
Inspection shall include any part of the system located more than 5 feet from the primary structure that is part of the operations permit:	Yes
Copy of Operations permit from County Environmental Health attached	No
Issuing County:	N/A
Operations permit unavailable?	Yes
System requires a certified subsurface water pollution control system operator pursuant to G.S. 90A-44:	No
Current operator's name:	N/A
Most recent performance, operation and maintenance reports available?	No
Type of water supply:	shared well
Location of Septic Tank and Septic Tank Details	
Distance in feet from house or structure:	9 feet
Distance in feet from well or spring (if applicable):	Over 100 feet
Distance in feet from water line (if applicable):	Unknown
Distance in feet from property line if said property lines are known or marked:	Unknown
Access risers present?	No
Inlet tank lid intact?	Yes
Inlet tank lid description:	Square concrete lid with no handle.
Outlet tank lid intact?	Yes

Ambassador Inspections
 Brennan Smith
BrennanSmith2896@outlook.com
 Brennan Smith: 984-255-3633
 Robert Smith: 919-339-5633
 PO Box 337
 Bunn, NC 27508

Outlet tank lid description:	Square concrete lid.
Baffle wall condition:	no baffle wall
Inflow tank is noted as:	sufficient
Is water level in tank relative to tank outlet?	No
Is water level in tank relative to tank outlet description:	*** The water level appears to be 6 inches below the outlet pipe.
Outlet T present?	Yes
Outlet T description:	Concrete tee in fair condition.
Outlet filter present?	No
Effluent leaves the outlet?	Yes
Roots present in tank?	No
Evidence of tank leakage?	Yes
Evidence of tank leakage description:	***The water level appears to be 6 inches below the outlet pipe. Recommend doing a leak test to see if the leak is within allowable limits.
Evidence of non-permitted connections?	No
Connection present from house to tank?	Yes
Connection present from tank to next component?	Yes
Percentage of solids in tank:	35%
Date tank was last pumped:	Unknown.
Client has declined to have the tank pumped at inspection.	
Pump Tank	
Pump tank present?	No
Access riser description:	N/A
Distribution Box	
Distribution box present?	Yes
Distribution box description:	*** Rectangular concrete box that is corroded and needs to be replaced. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.
Dispersal Field	
System type:	conventional
Pretreatment present?	No
Distance in feet from property line if said property lines are known or marked:	Unknown
Number of lines:	4
Length of lines:	Approximately 240 feet of leach line was found.

Ambassador Inspections
 Brennan Smith
BrennanSmith2896@outlook.com
 Brennan Smith: 984-255-3633
 Robert Smith: 919-339-5633
 PO Box 337
 Bunn, NC 27508

Evidence of past or current surfacing?	No
Vegetation, grading and/or drainage noted that may affect the conditions the system or system components present?	Yes
System conditions description:	*** There are trees in the leach field.
Effluent is reaching the dispersal field?	Yes
Inspection Conditions	
Conditions present that prevented or hindered the inspection?	No
Adverse conditions present that require repair or subsequent observation or warrents further evaluation by the local health department?	No
Other pertinent facts noted during inspection:	***The leach lines are full of mud and solids. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.
Inspected By	
Inspector:	Brennan
Certification #	130541
Inspector Address:	PO Box 337, Bunn, NC 27508
Inspector Phone:	(984) 255-3633
Disclaimer:	No representation, warranties or opinions are hereby given, written or expressed otherwise, as to the future performance of onsite wastewater system described herein. This onsite wastewater system inspection is a presentation of system facts in place on date of inspection.
Signature:	Brennan Smith
Summary	

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508

Summary:	***1. The septic tank needs to be pumped. 2. The outlet tee is in fair condition. ***3. The water level appears to be 6 inches below the outlet pipe. Recommend doing a leak test to see if the leak is within allowable limits. ***4. The distribution box needs to be replaced. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue. ***5. The leach lines are full of mud and solids. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue. ***6. There is a blockage in the number one leach line at 26 ft. I could not get my camera to go past it. ****7. There are trees in the leach field.
------------------------	---

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the inlet end of the septic tank with the inlet pipe. The septic tank needs to be pumped.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the outlet end of the septic tank with the outlet tee. The outlet tee is in fair condition. The water level appears to be 6 inches below the outlet pipe. Recommend doing a hydrostatic leak test to see if the leak is within allowable limits.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the distribution box. It is corroded and needs to be replaced.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508




The leach lines have mud and solids in them. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the leach field. There are trees in the leach field.

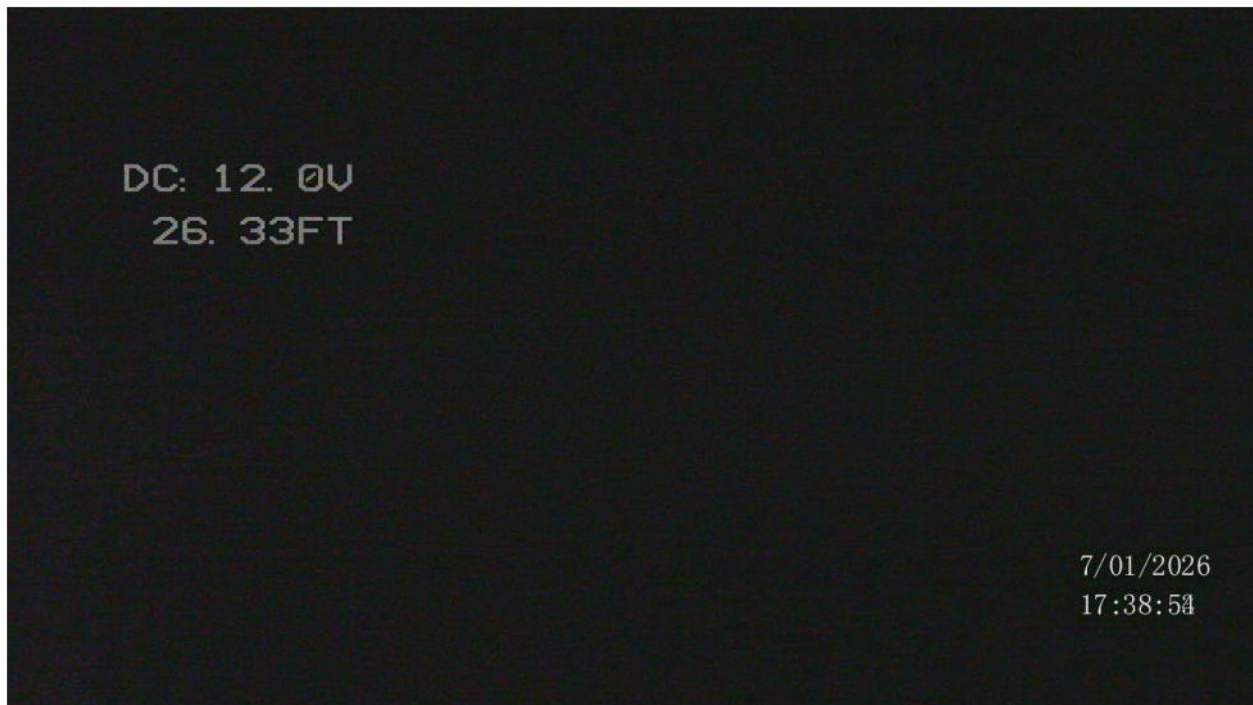

There is a blockage at 26 ft. mark in the first leach line.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



The inlet end lid has no handle.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



The house shares a well with 2 other properties. The well is on the neighbor's land in the backyard.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508