




System: - - - - -
Repair: _____

[ST] = 1250 gallon tank with risers
[PT] = 1500 gallon tank with risers
● = profile description locations #2



- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

Initial System: Pressure Manifold
Lines: 1-6, (540')
Accepted Status System (25% reduction)
0.3 Soil LTAR
21" Trench Bottom on the downhill side

Repair System: Pressure Manifold
Lines: 7-12, (355')
T&J Panel Block System (horizontal)
0.3 Soil LTAR
21" Trench Bottom on the downhill side

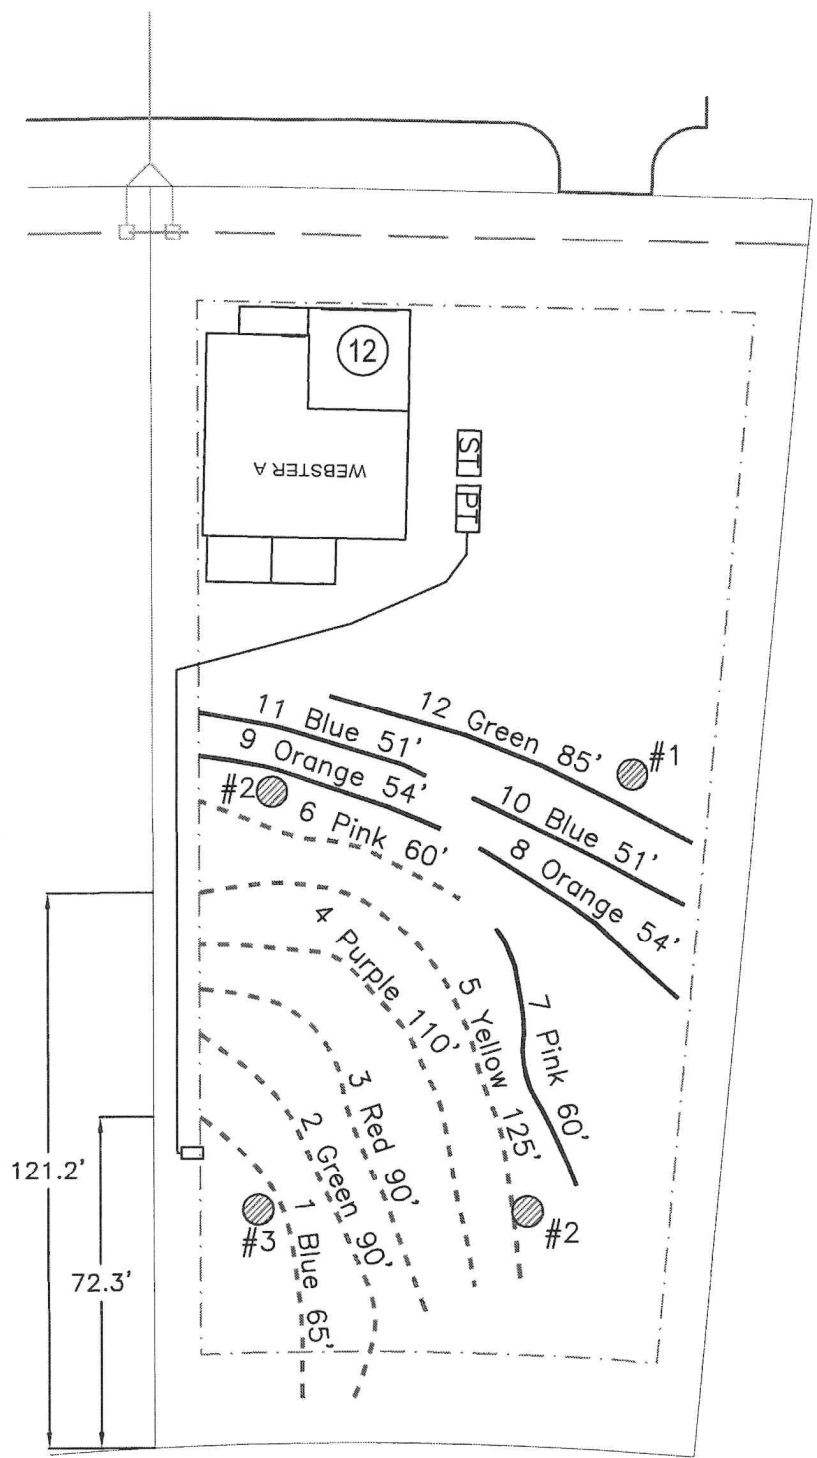

GRAPHIC SCALE
1" = 40'

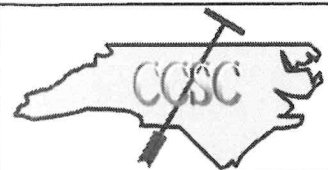

Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

5-Bedroom Septic Layout
Lot 12, Maison Ridge Subdivision
Franklin County, North Carolina

Job#: 4862
Drawn By: JR
Date: 01/20/2025
Revision: