


Initial System: Pressure Manifold
 Lines: 5–8, (400')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 30" trench bottom on the downhill side

Repair System: Pressure Manifold
 Lines: 1–4, (485')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 30" trench bottom on the downhill side

System: ---
 Repair: ---
 [ST] = 1200 gallon tanks with risers
 [PT] = profile description locations
 #1 = profile description locations

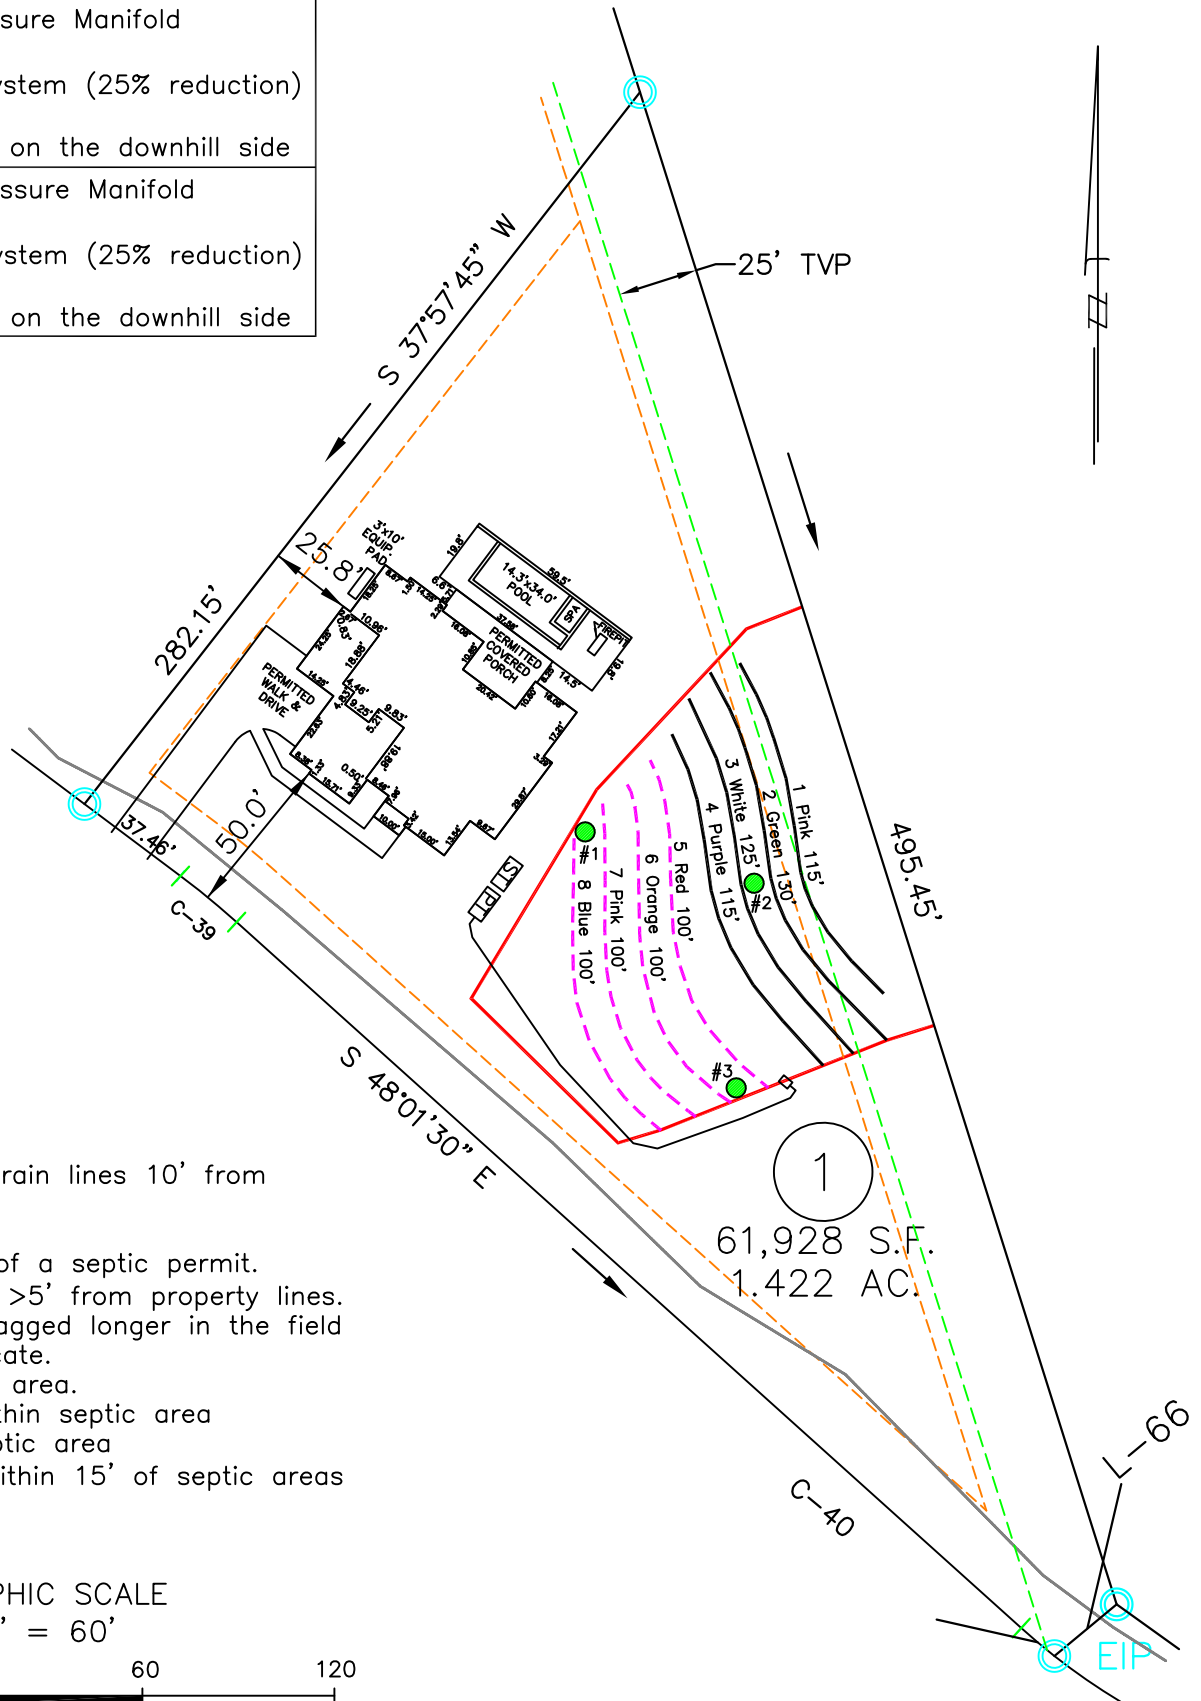

- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

GRAPHIC SCALE
 1" = 60'



Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 1, Sanctuary at Falls Lake Subdivision
 Wake County, North Carolina

Job#: 5212
 Drawn By: JR
 Date: 06/16/2025
 Revision: 07/23/2025