

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



Ambassador Inspections
 Brennan Smith
BrennanSmith2896@outlook.com
 Brennan Smith: 984-255-3633
 Robert Smith: 919-339-5633
 PO Box 337
 Bunn, NC 27508

Property Address	
Street:	1101 Heritage Dr
City:	Wendell
State:	NC
ZIP:	27591
Client Information	
Client Name:	ENN LLC
Inspection Details	
Date of Inspection:	08/13/2026 14:31
Advertised number of bedrooms as stated in MLS or as stated in attached in sworn statement by owner or owner's representative:	3 bedrooms
Designed system size or number of bedrooms as stated in available local health department information in gallons per day:	360 gallons per day
Inspection shall include any part of the system located more than 5 feet from the primary structure that is part of the operations permit:	Yes
Copy of Operations permit from County Environmental Health attached	No
Issuing County:	N/A
Operations permit unavailable?	Yes
System requires a certified subsurface water pollution control system operator pursuant to G.S. 90A-44:	No
Current operator's name:	N/A
Most recent performance, operation and maintenance reports available?	No
Type of water supply:	community water
Location of Septic Tank and Septic Tank Details	
Distance in feet from house or structure:	6 feet
Distance in feet from well or spring (if applicable):	Unknown. Its on a community well per the home inspector.
Distance in feet from water line (if applicable):	Unknown
Distance in feet from property line if said property lines are known or marked:	Unknown
Access risers present?	No
Inlet tank lid intact?	Yes
Inlet tank lid description:	Rectangular concrete lid.
Outlet tank lid intact?	Yes

Ambassador Inspections
 Brennan Smith
BrennanSmith2896@outlook.com
 Brennan Smith: 984-255-3633
 Robert Smith: 919-339-5633
 PO Box 337
 Bunn, NC 27508

Outlet tank lid description:	Rectangular concrete lid in good condition.
Baffle wall condition:	no baffle wall
Inflow tank is noted as:	sufficient
Is water level in tank relative to tank outlet?	Yes
Outlet T present?	Yes
Outlet T description:	Plastic tee in fair condition.
Outlet filter present?	No
Effluent leaves the outlet?	Yes
Roots present in tank?	Yes
Evidence of tank leakage?	No
Evidence of non-permitted connections?	No
Connection present from house to tank?	Yes
Connection present from tank to next component?	Yes
Percentage of solids in tank:	35%
Date tank was last pumped:	Unknown.
Client has declined to have the tank pumped at inspection.	
Pump Tank	
Pump tank present?	No
Access riser description:	N/A
Distribution Box	
Distribution box present?	Yes
Distribution box description:	***** Rectangular concrete box that is corroded and needs to be replaced. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.
Dispersal Field	
System type:	conventional
Pretreatment present?	No
Distance in feet from property line if said property lines are known or marked:	Unknown
Number of lines:	2
Length of lines:	150 feet each per the permit.
Evidence of past or current surfacing?	No
Vegetation, grading and/or drainage noted that may affect the conditions the system or system components present?	Yes

Ambassador Inspections
 Brennan Smith
BrennanSmith2896@outlook.com
 Brennan Smith: 984-255-3633
 Robert Smith: 919-339-5633
 PO Box 337
 Bunn, NC 27508

System conditions description:	There are trees in the leach field.
Effluent is reaching the dispersal field?	Yes
Inspection Conditions	
Conditions present that prevented or hindered the inspection?	No
Adverse conditions present that require repair or subsequent observation or warrents further evaluation by the local health department?	No
Other pertinent facts noted during inspection:	*** The leach lines are full of solids and will not function properly at this time. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.
Inspected By	
Inspector:	Brennan
Certification #	130541
Inspector Address:	PO Box 337, Bunn, NC 27508
Inspector Phone:	(984) 255-3633
Disclaimer:	No representation, warranties or opinions are hereby given, written or expressed otherwise, as to the future performance of onsite wastewater system described herein. This onsite wastewater system inspection is a presentation of system facts in place on date of inspection.
Signature:	Brennan Smith
Summary	

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508

Summary:	***1. The septic tank needs to be pumped. 2. The outlet tee is in fair condition. ***3. The distribution box needs to be replaced. ***4. The leach lines are full of solids and will not function properly at this time. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue. ***5. There are trees in the leach field. 6. There were no signs of surfacing in the leach field.
-----------------	--

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508

Environmental Services - Water Quality
Onsite Wastewater Scan Data Entry Form

PERMIT #: **A 0 0 2 9 5 2**

PIN #: **1 7 8 5 3 0 6 1 6 1**

OP DATE: **0 6 / 2 8 / 1 9 7 2**

SYSTEM USE:

- ☒ House
☐ Mobile Home
☐ Business
☐ Other

SEWAGE TYPE:

- ☒ Domestic
☐ Industrial

PUMP/SIPHON?:

- ☐ Yes
☒ No

PRESSURE MANIFOLD:

- ☐ Yes
☒ No

SYSTEM TYPE:

- ☐ I
☒ II
☐ III
☐ IV
☐ V
☐ VI
☐ Other

SUB TYPE:

- ☒ A
☐ B
☐ C
☐ D
☐ E
☐ F
☐ G

NBR BEDROOMS:

- ☐ 1
☐ 2
☒ 3
☐ 4
☐ 5
☐ 6
☐ Other

MAINT. SCHEDULE:

- ☐ Yes
☒ No

CERT. OPERATOR

- ☐ Yes
☒ No

GT	ST	PT	SIZE
☐	☐		750
☐	☒	☐	900
☐	☐	☐	1,000
☐	☐	☐	1,200
☐	☐	☐	1,500
☐	☐	☐	1,800
☐	☐	☐	2,100
☐	☐	☐	2,500
☐	☐	☐	3,000
☐	☐	☐	4,000
☐	☐	☐	5,000
☐	☐	☐	8,000
☐	☐	☐	10,000
☐	☐	☐	Other
☒		☒	None/NA GT or PT

DRAINFIELD SIZE(SQ. FT.)

0 0 9 0 0

DRAIN TYPE:

- ☒ Stone
☐ EZ Flow
☐ Infiltrator
☐ Biodiffuser
☐ Cultec
☐ Drip
☐ Hancor
☐ Large Dia. Pipe
☐ Multi-Pipe
☐ Other

MAX DEPTH (IN.):

- ☐ 12 in. or less
☐ 18 in. or less
☐ 24 in. or less
☐ 26 in. or less
☐ 28 in. or less
☐ 30 in. or less
☐ 32 in. or less
☐ 36 in. or less
☒ Other

STONE DEPTH (IN.):

- ☐ 8 in. or less
☐ 12 in. or less
☐ 18 in. or less
☐ 24 in. or less
☒ Other

TRENCHES:

- ☐ Individual
☒ Bed

TRENCH WIDTH (IN.):

- ☐ 12 in. or less
☐ 18 in.
☐ 24 in.
☐ 36 in.
☒ 6 ft. or less
☐ 9 ft. or less
☐ Other

KH

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508

WAKE COUNTY HEALTH DEPARTMENT
SEPTIC TANK LAYOUT AND PERMIT

1785 30 6161

PERMIT NO. **A 2952**

OWNER

WILLIAM GAY / GALILEE VILLAGE

DATE

9.21.92

GENERAL CONTRACTOR

LOCATION

64 Bacon St. Durham

LOT 20

NO. BEDROOMS

3

LOT AREA

281

GARBAGE DISPOSAL UNIT

PERC. TEST (1)

(2)

(3)

IPH

SIZE OF TANK

900

gal

NITRIFICATION LINE

6.4 x 150' 900

sq. ft.

SAND FILTER

6000

sq. ft.

WATER SUPPLY:

Type

Approved

Driller

LAYOUT BY

M. Smith

DATE


6-23-92

INSTALLED BY

Brennan Smith

APPROVED BY

M. Smith

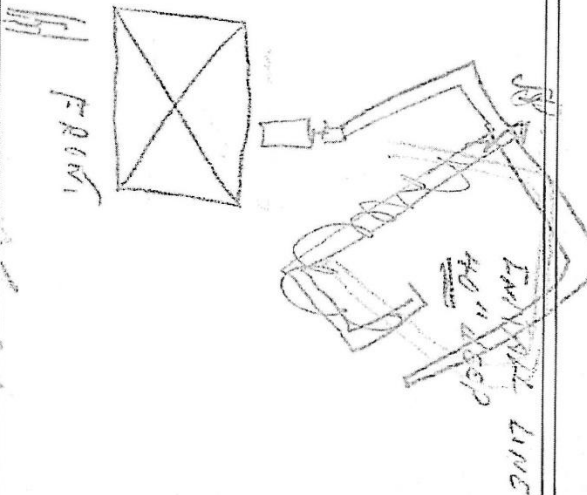

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the inlet end of the septic tank with the inlet pipe. The septic tank needs to be pumped.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the outlet end of the septic tank with the outlet tee. The outlet tee is in good condition.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the distribution box. It is corroded and needs to be replaced. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



The leach lines are blocked and will not function properly at this time. Recommend contacting a licensed septic company to come out and see what can be done to fix the issue.

Ambassador Inspections
Brennan Smith
BrennanSmith2896@outlook.com
Brennan Smith: 984-255-3633
Robert Smith: 919-339-5633
PO Box 337
Bunn, NC 27508



This is the leach field. There are trees in the leach field.