


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

System: ---
 Repair: ---

ST = 1200 gallon tank with risers
● #2 = profile description locations

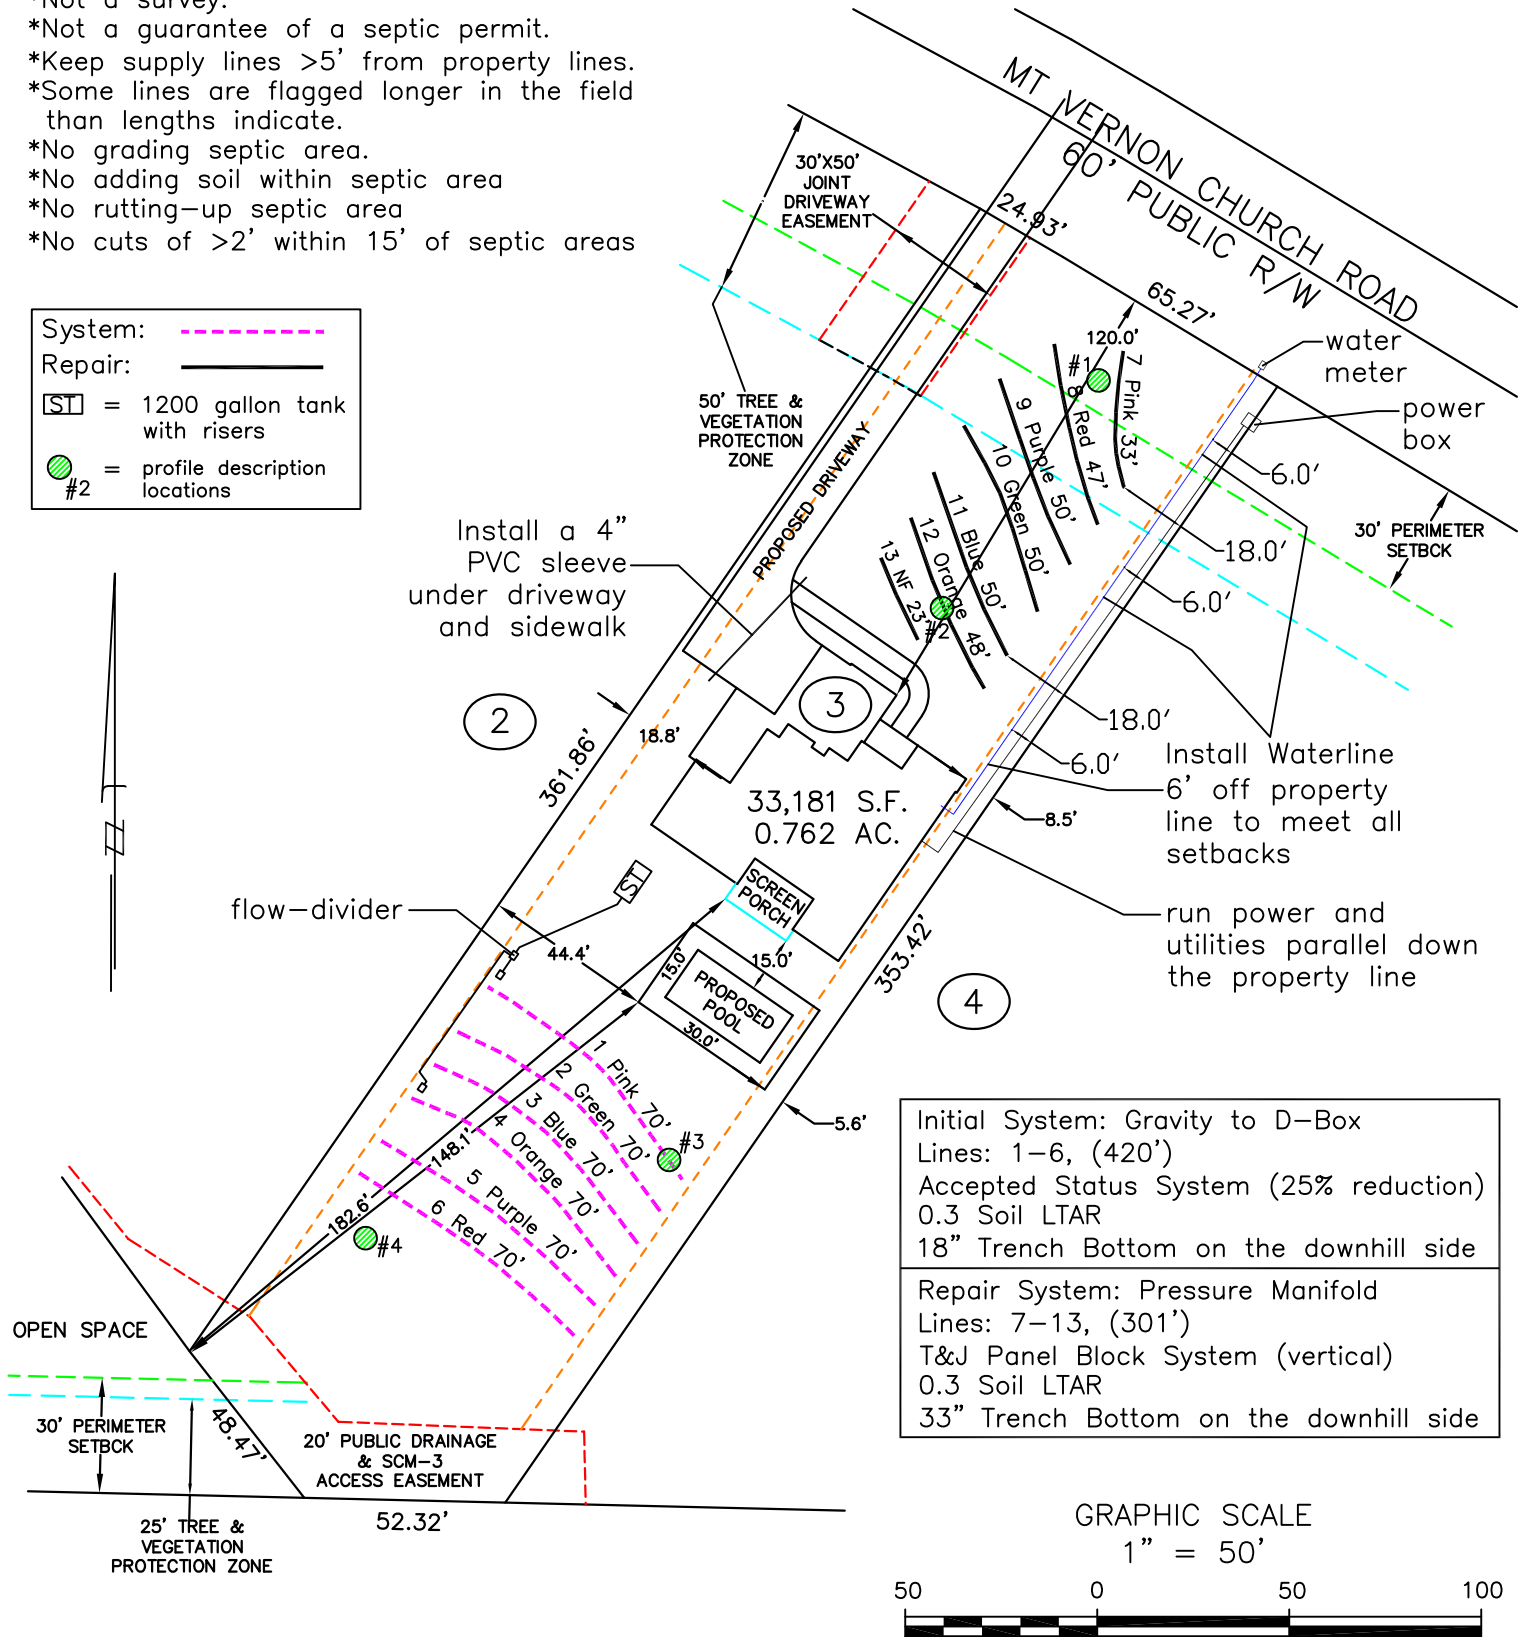

Initial System: Gravity to D-Box
 Lines: 1-6, (420')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 18" Trench Bottom on the downhill side

Repair System: Pressure Manifold
 Lines: 7-13, (301')
 T&J Panel Block System (vertical)
 0.3 Soil LTAR
 33" Trench Bottom on the downhill side



Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 3, The Overlook at Mount Vernon
 Wake County, North Carolina

Job#: 5304
 Drawn By: JR
 Date: 09/08/2025
 Revision: