


Repair System: Pressure Manifold
Lines: 6-9, (268')
T&J Panel Block System (vertical)
0.3 Soil LTAR
30" Trench Bottom on the downhill side

- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting—up septic area
- *No cuts of >2' within 15' of septic areas



GRAPHIC SCALE
1" = 40'

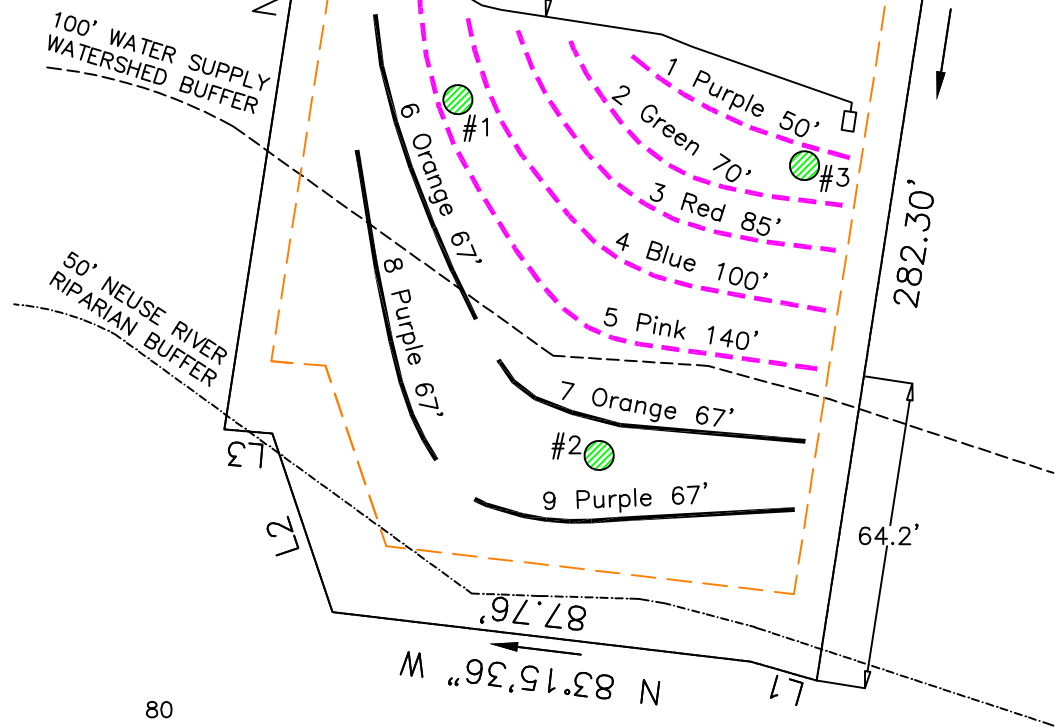

$\boxed{\text{PT}}$ = 1200 gallon pump tank with risers

 #2 = profile description locations



Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
Lot 12, Sanctuary at Lake Wheeler
Wake County, North Carolina

Job#: 5282
Drawn By: JR
Date: 09/04/2025
Revision: