

Radon Test Report

Test Location:

Helene Headington
2946 Glenridge Dr
Raleigh, NC 27604
heleneheadington10@gmail.com
919-356-4040

Test Performed By:

Logan Brown
Openwindow Home Inspection
919-898-2626



Radon
Test.
Report.
Prevent.

Test Result: Fail

Overall Average:

4.1 pCi/l

EPA Average:

4.4 pCi/l

Test Device Details:

SunRADON CRM:	1028XP
Serial Number:	400000308
Last Calibration:	10/24/2024
Next Calibration:	10/24/2025
Cal-Factors:	2.09
Motion Error:	No

Test Summary:

CRM Location:	Start:	Stop:	Interval:	Duration:
	12/16/2024 01:52 PM	12/18/2024 01:52 PM	1 hr	48 hr

Test Details:

*First 4 hrs of data excluded	Min	Max	Average	Units
Radon Concentration	0.5	9.1	4.4	pCi/l
Temperature	57.0	66.4	60.5	F
Humidity	60	73	68	%
Pressure	29.87	30.07	30.01	inHg

Comments:

Inspector Signature

Test Location:

2946 Glenridge Dr
Raleigh, NC 27604

Inspection Report Date:

12/18/2024



Monitor your Air, Protect your Health with lüft©


 Scan QR-code or visit luftair.com to learn more!



Test device manufactured by SunRADON, LLC

OneRADON™ Version 2.4.53

Radon Inspection Chart

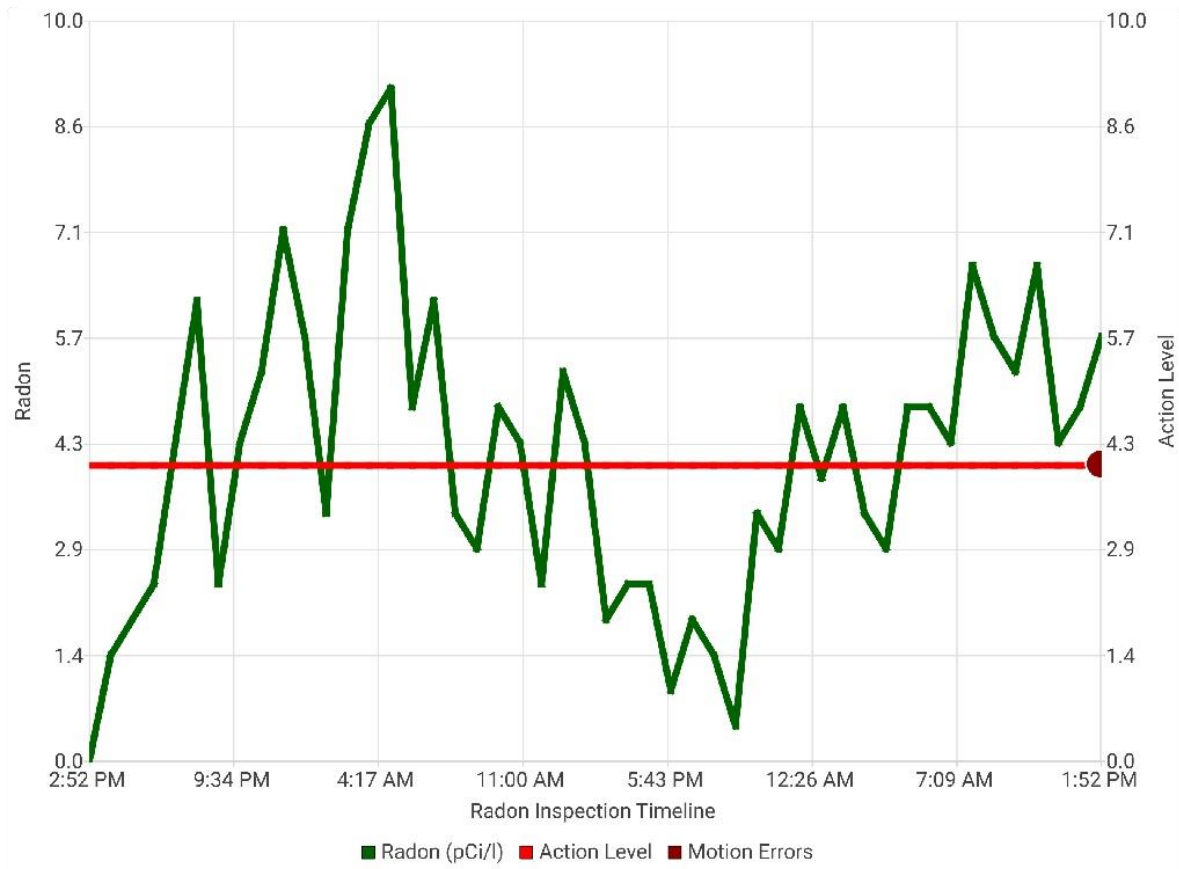

Test device manufactured by SunRADON, LLC

Test Result: Fail

Test Location: 2946 Glenridge Dr
Raleigh , NC 27604

Inspection Report Date:
12/18/2024

Test Table

(*Data from first 4 hours excluded from EPA calculations)

The test data was taken from a testing device approved by the National Radon Proficiency Program. The test was performed in accordance with the current ANSI/AARST standards and guidelines accepted for radon testing.

Date/Time	Radon(pCi/l)	Temp(F)	Pres(inHg)	Humidity(%)	Flags
12/16/24 02:52 PM	0.0	64.6	30.07	61	-
12/16/24 03:52 PM	1.4	67.5	30.06	59	-
12/16/24 04:52 PM	1.9	69.8	30.05	58	-
12/16/24 05:52 PM	2.4	68.2	30.06	59	-
12/16/24 06:52 PM	4.3	66.4	30.07	60	-
12/16/24 07:52 PM	6.2	64.9	30.07	61	-
12/16/24 08:52 PM	2.4	63.9	30.07	62	-
12/16/24 09:52 PM	4.3	62.8	30.06	63	-
12/16/24 10:52 PM	5.3	62.1	30.06	63	-
12/16/24 11:52 PM	7.2	61.3	30.06	64	-
12/17/24 12:52 AM	5.7	60.6	30.04	64	-
12/17/24 01:52 AM	3.3	60.1	30.03	65	-
12/17/24 02:52 AM	7.2	59.4	30.01	65	-
12/17/24 03:52 AM	8.6	59.0	30.00	66	-
12/17/24 04:52 AM	9.1	58.5	29.99	66	-
12/17/24 05:52 AM	4.8	58.1	30.00	67	-
12/17/24 06:52 AM	6.2	57.9	30.01	67	-
12/17/24 07:52 AM	3.3	57.6	30.02	68	-
12/17/24 08:52 AM	2.9	57.2	30.03	68	-
12/17/24 09:52 AM	4.8	57.0	30.04	69	-
12/17/24 10:52 AM	4.3	57.2	30.05	69	-
12/17/24 11:52 AM	2.4	57.4	30.03	69	-
12/17/24 12:52 PM	5.3	57.9	30.00	69	-
12/17/24 01:52 PM	4.3	58.8	29.98	69	-
12/17/24 02:52 PM	1.9	60.1	29.98	69	-
12/17/24 03:52 PM	2.4	61.2	29.97	69	-
12/17/24 04:52 PM	2.4	61.7	29.98	68	-
12/17/24 05:52 PM	1.0	62.1	29.99	68	-
12/17/24 06:52 PM	1.9	62.2	30.00	68	-
12/17/24 07:52 PM	1.4	62.2	30.01	68	-
12/17/24 08:52 PM	0.5	62.2	30.02	68	-
12/17/24 09:52 PM	3.3	62.1	30.03	69	-
12/17/24 10:52 PM	2.9	62.1	30.03	69	-
12/17/24 11:52 PM	4.8	61.9	30.03	69	-
12/18/24 12:52 AM	3.8	61.5	30.04	70	-
12/18/24 01:52 AM	4.8	61.3	30.03	70	-
12/18/24 02:52 AM	3.3	61.0	30.03	70	-
12/18/24 03:52 AM	2.9	60.8	30.03	70	-
12/18/24 04:52 AM	4.8	60.4	30.02	70	-
12/18/24 05:52 AM	4.8	60.1	30.00	71	-
12/18/24 06:52 AM	4.3	59.7	30.00	71	-
12/18/24 07:52 AM	6.7	59.4	29.99	71	-
12/18/24 08:52 AM	5.7	59.2	30.00	71	-
12/18/24 09:52 AM	5.3	59.0	30.00	72	-
12/18/24 10:52 AM	6.7	59.0	29.99	72	-
12/18/24 11:52 AM	4.3	59.2	29.96	72	-
12/18/24 12:52 PM	4.8	61.3	29.91	73	-
12/18/24 01:52 PM	5.7	62.2	29.87	72	M

Test Result: Fail

Test Location: 2946 Glenridge Dr
Raleigh , NC 27604

Inspection Report Date:
12/18/2024

Test device manufactured by SunRADON, LLC

Property Pictures



Location: Living Room

Test Result: Fail

Test Location: 2946 Glenridge Dr
Raleigh , NC 27604

Inspection Report Date:
12/18/2024
