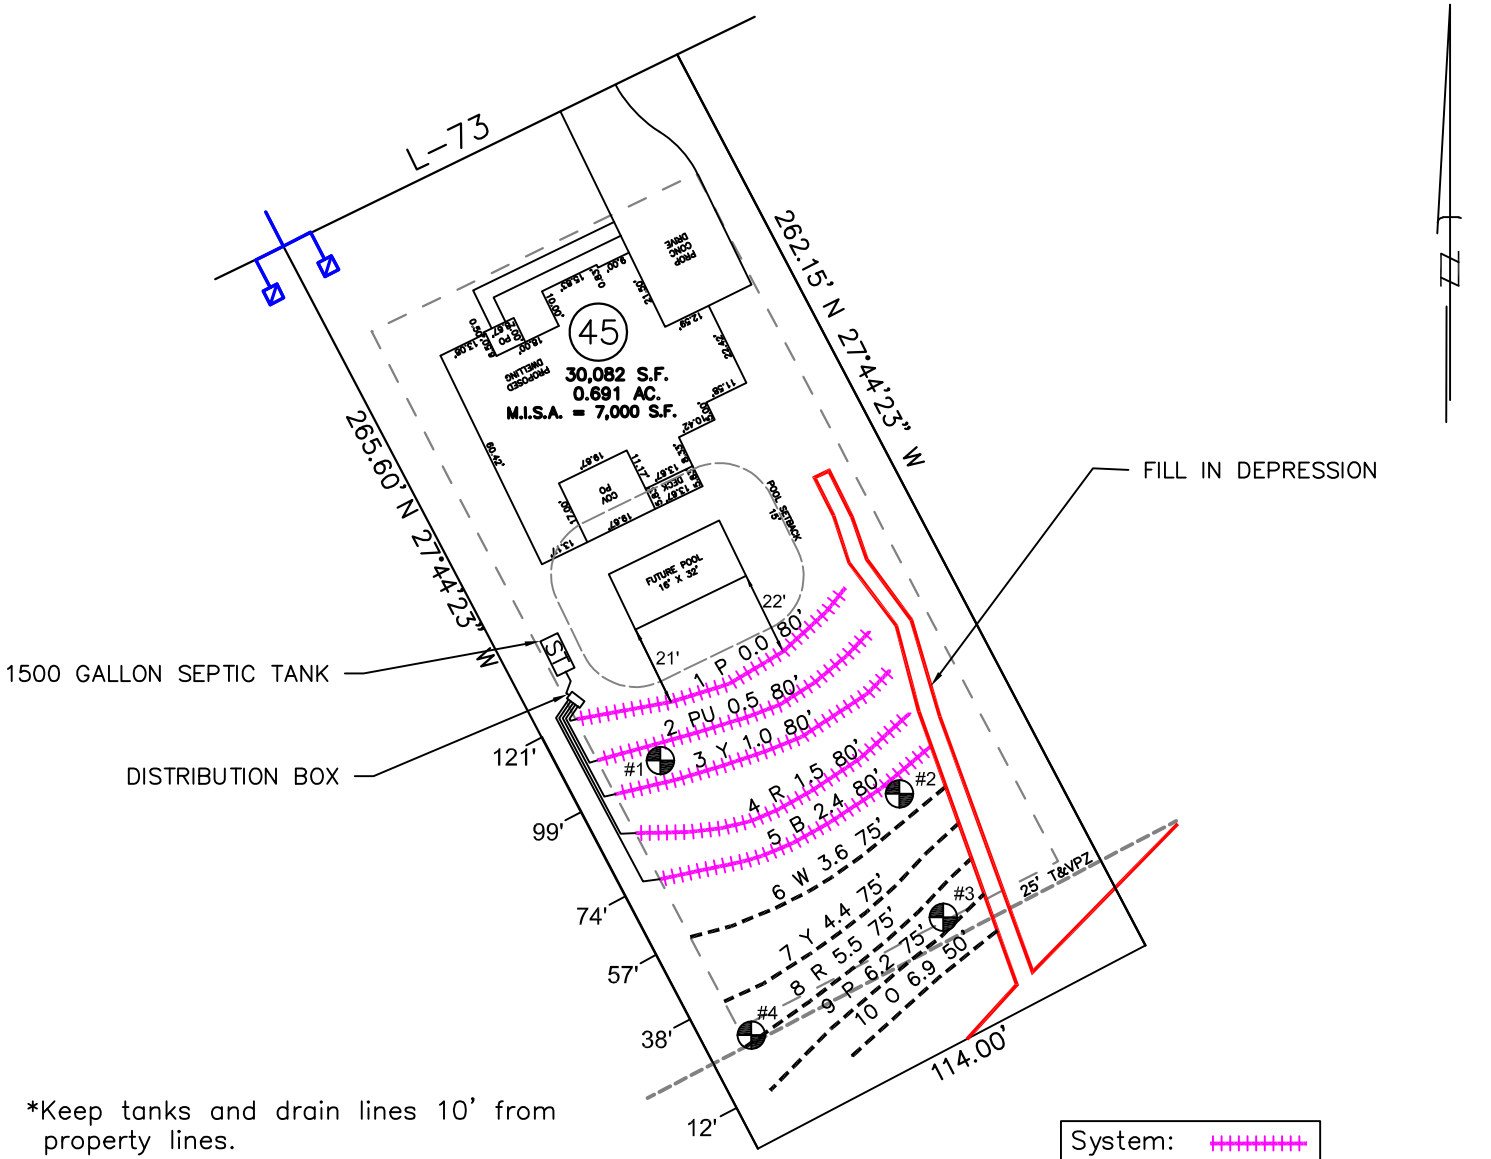


*Keep tanks and drain lines 10' from property lines.
*Not a survey.
*Not a guarantee of a septic permit.
*Keep supply lines >5' from property lines.
*Some lines are flagged longer in the field than lengths indicate.
*No grading septic area.
*No adding soil within septic area
*No rutting–up septic area
*No cuts of >2' within 15' of septic areas

System:
Repair:
Repair: #1

Initial System: Gravity to Dist. Box
Lines: 1–5, (400')
Accepted Status System
0.4 Soil LTAR
18" TRENCH BOTTOM

Repair System: Gravity to Dist. Box
Lines: 6–10, (350')
T&J Panel Block (Horizontal)
0.4 Soil LTAR
18" TRENCH BOTTOM

GRAPHIC SCALE
1" = 50'
50 0 50 100

Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569–6704 Fax (919)569–6703

5-Bedroom Septic Layout
Lot 45, Carriage Farm Subdivision
Wake County, North Carolina

Job#: 5209
Drawn By: MB
Date: 08/08/2025
Revision: