


- \*Keep tanks and drain lines 10' from property lines.
- \*Not a survey.
- \*Not a guarantee of a septic permit.
- \*Keep supply lines >5' from property lines.
- \*Some lines are flagged longer in the field than lengths indicate.
- \*No grading septic area.
- \*No adding soil within septic area
- \*No rutting-up septic area
- \*No cuts of >2' within 15' of septic areas


System: ---  
 Repair: ---  
 Boring: ●  
 ST-PT: 1200 Gallon

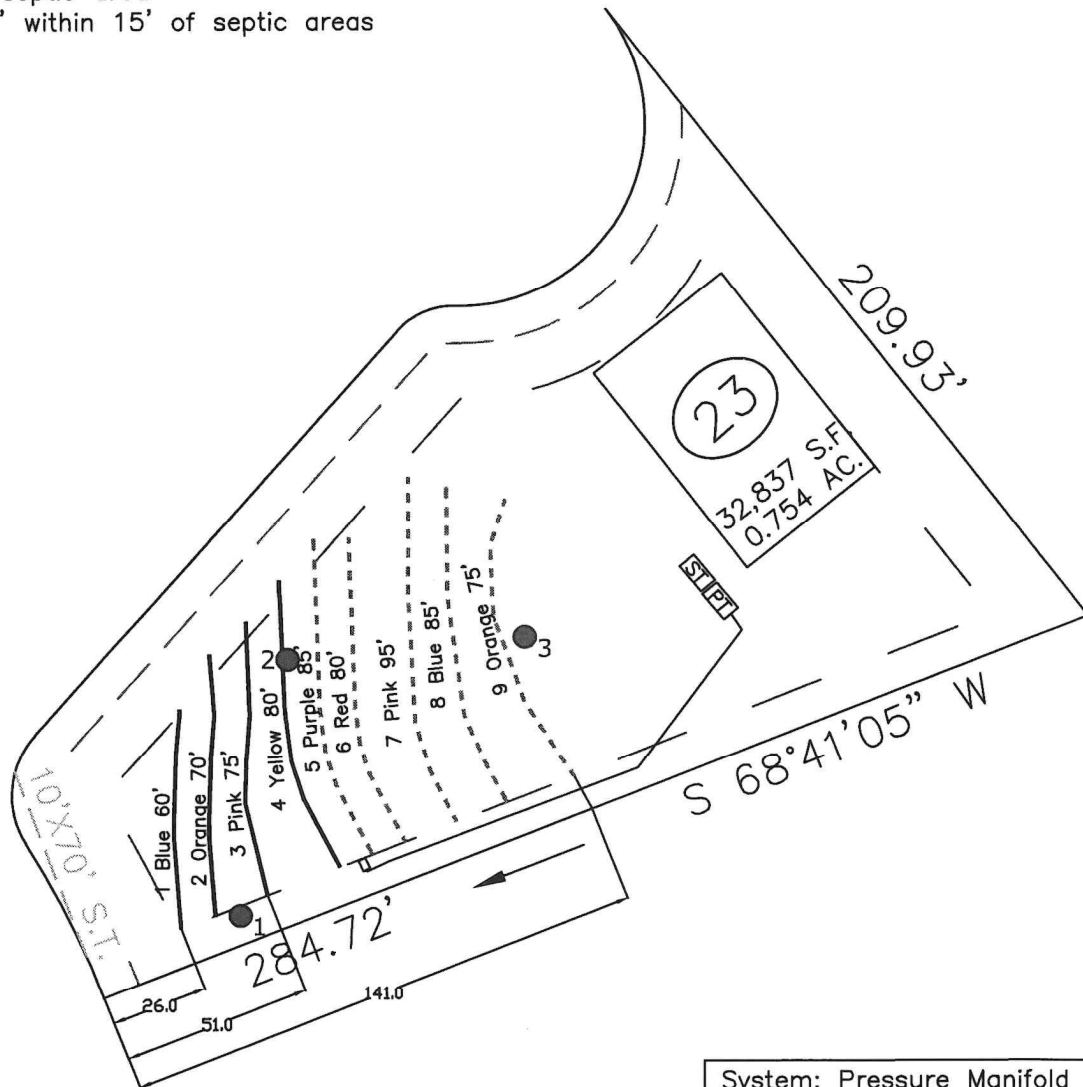

System: Pressure Manifold  
 Lines: 5-9, (420')  
 Accepted Status System  
 0.3 Soil LTAR  
 22" Trench Bottom

Repair: Pressure Manifold  
 Lines: 1-4, (285')  
 T&J Panel 50% Reduction  
 0.3 Soil LTAR  
 22" Trench Bottom

GRAPHIC SCALE  
 1" = 50'

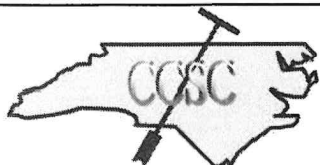

Central Carolina Soil Consulting, PLLC  
 1900 South Main Street, Suite 110  
 Wake Forest, North Carolina 27587  
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout  
 Lot 23, Maison Ridge Subdivision  
 Franklin County, North Carolina

Job#: 4862  
 Drawn By: AH  
 Date: 04/15/2024  
 Revision: