


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

System:	---
Repair:	---
Boring:	●
ST:	1250 Gallon
PT:	1300 Gallon




GRAPHIC SCALE
1" = 50'

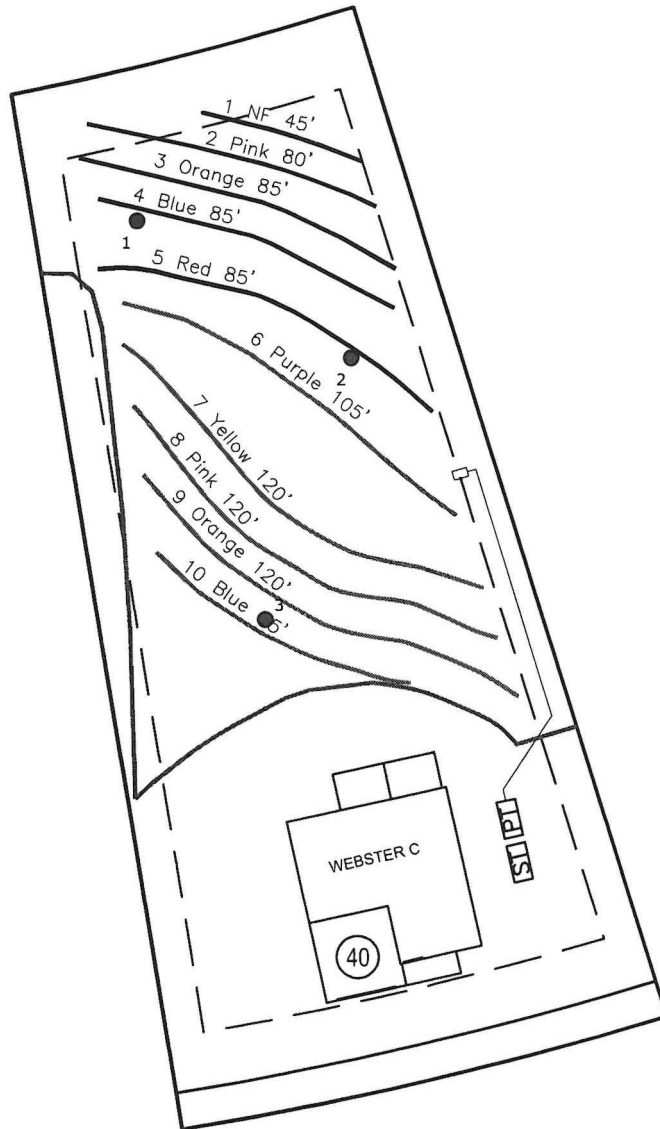

System: Pressure Manifold
Lines: 6-9, (540')
Accepted Status System
0.3 Soil LTAR
24" Trench Bottom

Repair: Pressure Manifold
Lines: 1-5, (380')
T&J Panel 50% Reduction
0.3 Soil LTAR
24" Trench Bottom

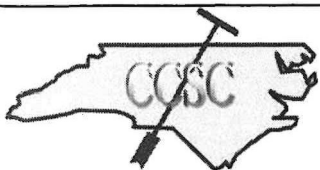

Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

5-Bedroom Septic Layout
Lot 40, Maison Ridge Subdivision
Franklin County, North Carolina

Job#: 4862
Drawn By: JR
Date: 05/6/2024
Revision: 09/05/2024