


System: - - -
 Repair: ———
 Boring: ●
 [ST] : 1250 Gallon

- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas




GRAPHIC SCALE
 1" = 50'

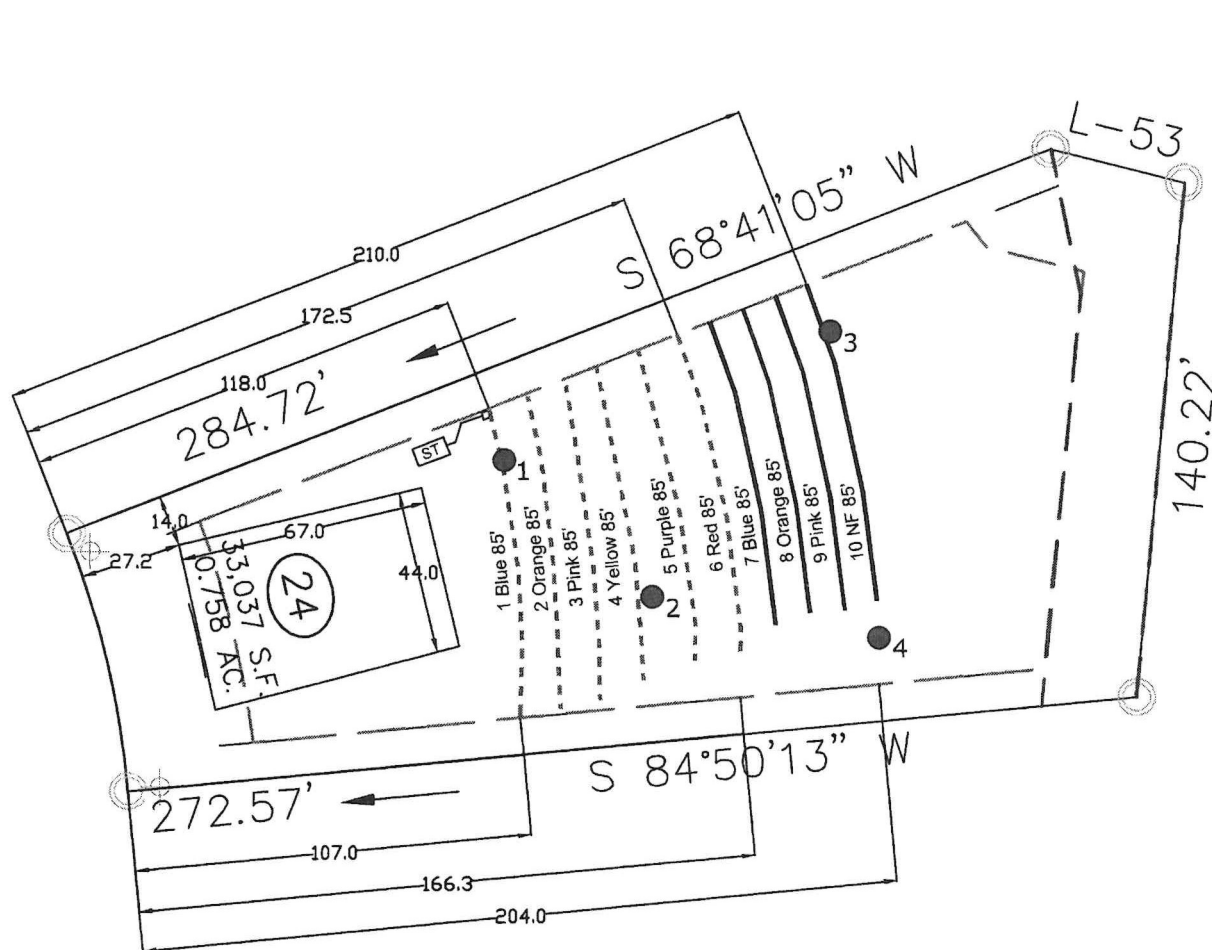

System: Gravity to Serial
 Lines: 1-6, (510')
 Accepted Status System
 0.3 Soil LTAR
 24" Trench Bottom

Repair: Pressure Manifold
 Lines: 7-10, (340')
 T&J Panel 50% Reduction
 0.3 Soil LTAR
 24" Trench Bottom

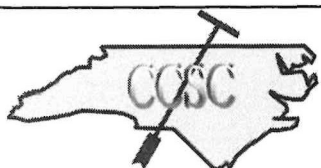

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

5-Bedroom Septic Layout
 Lot 24, Maison Ridge Subdivision
 Franklin County, North Carolina

Job#: 4862
 Drawn By: LW
 Date: 04/25/2024
 Revision: 05/01/2024