




System: - - - - -
Repair: —————
[ST] = 1000 gallon tank
with risers
#2 = profile description
locations

- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

Initial System: Gravity to Serial
Lines: 6-10, (420')
Accepted Status System (25% reduction)
0.3 Soil LTAR
30" Trench Bottom on the downhill side

Repair System: Gravity to Serial
Lines: 1-5, (290')
T&J Panel Block System (vertical)
0.3 Soil LTAR
30" Trench Bottom on the downhill side

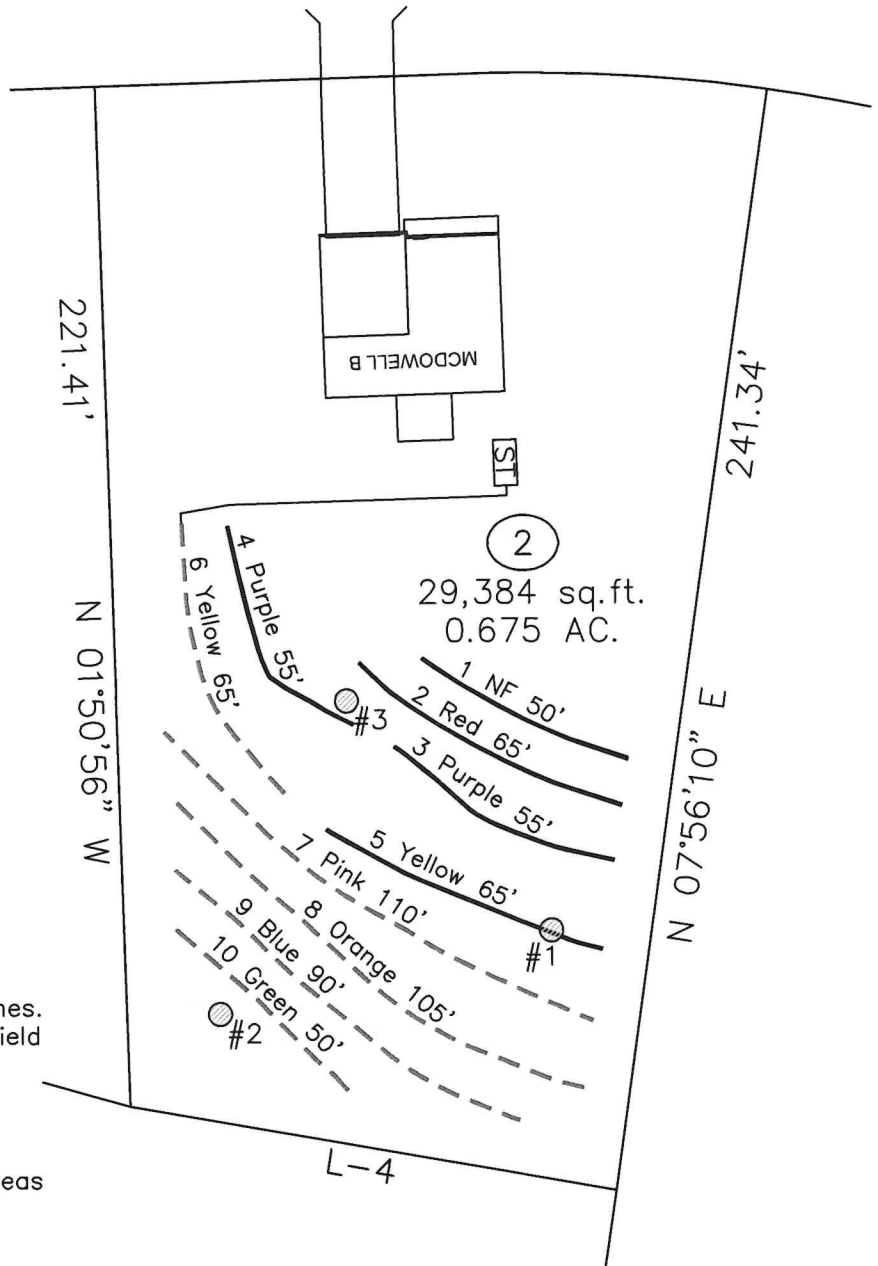

GRAPHIC SCALE
1" = 40'



Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
Lot 2, Olivet Subdivision
Franklin County, North Carolina

Job#: 4703
Drawn By: JR
Date: 04/28/2025
Revision: