

Initial System: Pressure Manifold
 Lines: 1-4, (480')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 18" Trench Bottom on the downhill side


Repair System: Pressure Manifold
 Lines: 5-7, (420')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 18" Trench Bottom on the downhill side

- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas



System:	----
Repair:	———
ST	= 1000 gallon tank with risers
PT	= 1000 gallon tank with risers
#2	= profile description locations

GRAPHIC SCALE
 1" = 50'

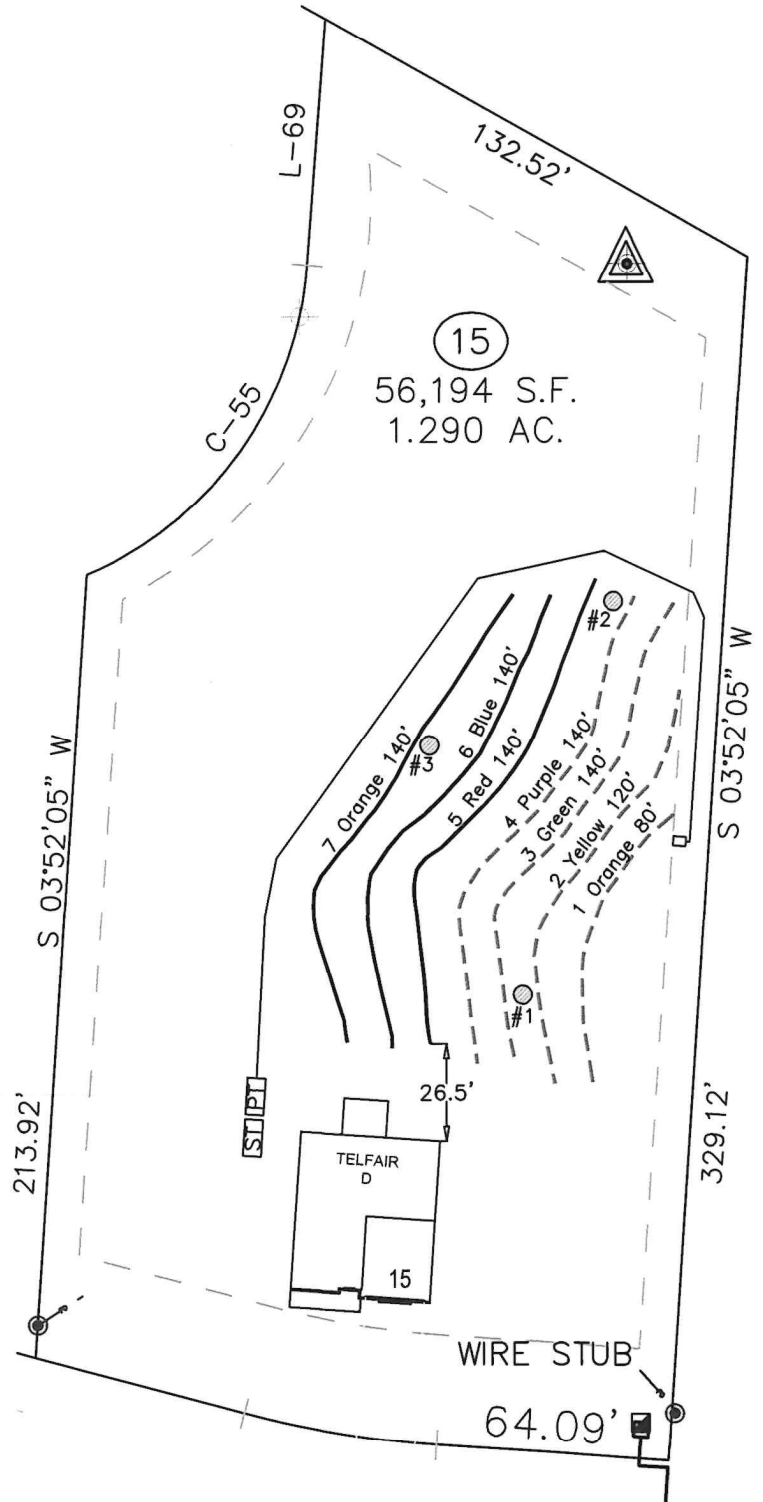

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 15, Olivet Subdivision
 Franklin County, North Carolina

Job#: 4703
 Drawn By: JH & PC
 Date: 03/24/2025
 Revision: