

System: -----
Repair: _____

ST

= 1000 gallon tank with risers

PT

= 1200 gallon tank with risers


⊙ #2

= profile description locations

Water Line must be >10' from tanks

Initial System: Pressure Manifold
Lines: 1-5, (480')
Accepted Status System (25% reduction)
0.3 Soil LTAR
26" Trench Bottom on the downhill side

Repair System: Pressure Manifold
Lines: 6-8, (450')
Accepted Status System (25% reduction)
0.3 Soil LTAR
26" Trench Bottom on the downhill side

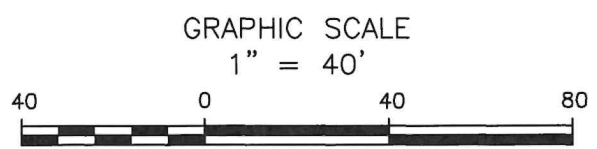

- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas



Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
Lot 17, Maison Ridge Subdivision
Franklin County, North Carolina

Job#: 4862
Drawn By: JR
Date: 05/04/2025
Revision: