


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

System: _____
 Repair: _____
 Boring: ●
 [ST]: 1250 Gallon
 [PT]: 1300 Gallon




GRAPHIC SCALE
 1" = 50'

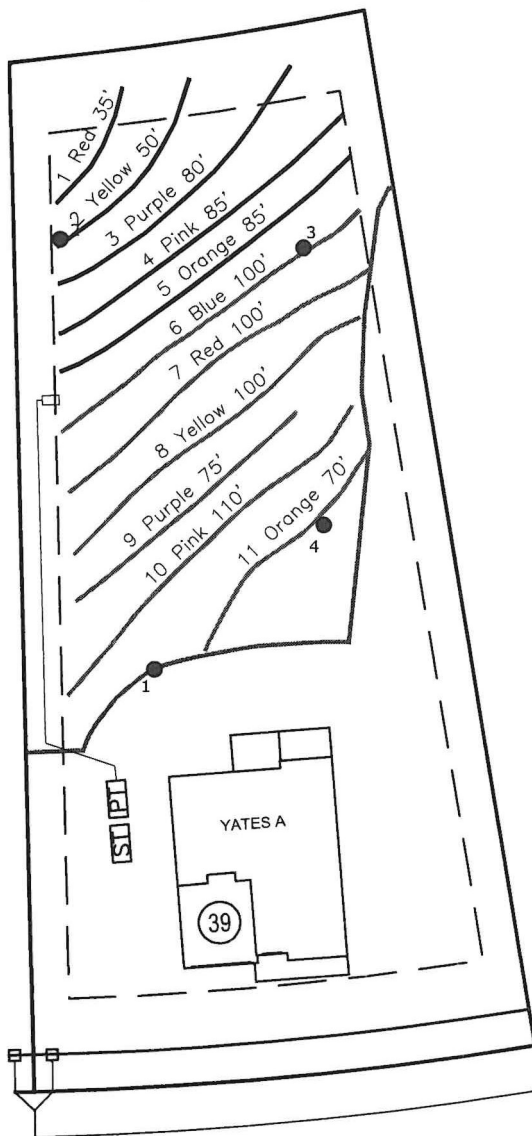

System: Pressure Manifold
 Lines: 6–11, (555')
 Accepted Status System
 0.3 Soil LTAR
 24" Trench Bottom

Repair: Pressure Manifold
 Lines: 1–5, (335')
 T&J Panel 50% Reduction
 0.3 Soil LTAR
 24" Trench Bottom

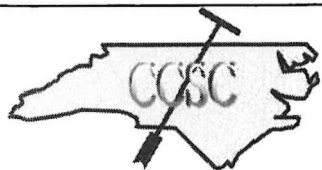

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

5-Bedroom Septic Layout
 Lot 39, Maison Ridge Subdivision
 Franklin County, North Carolina

Job#: 4862
 Drawn By: JR
 Date: 05/3/2024
 Revision: 09/05/2024