


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas


System: 
 Repair: 
 Boring: 
 ST : 1250 Gallon

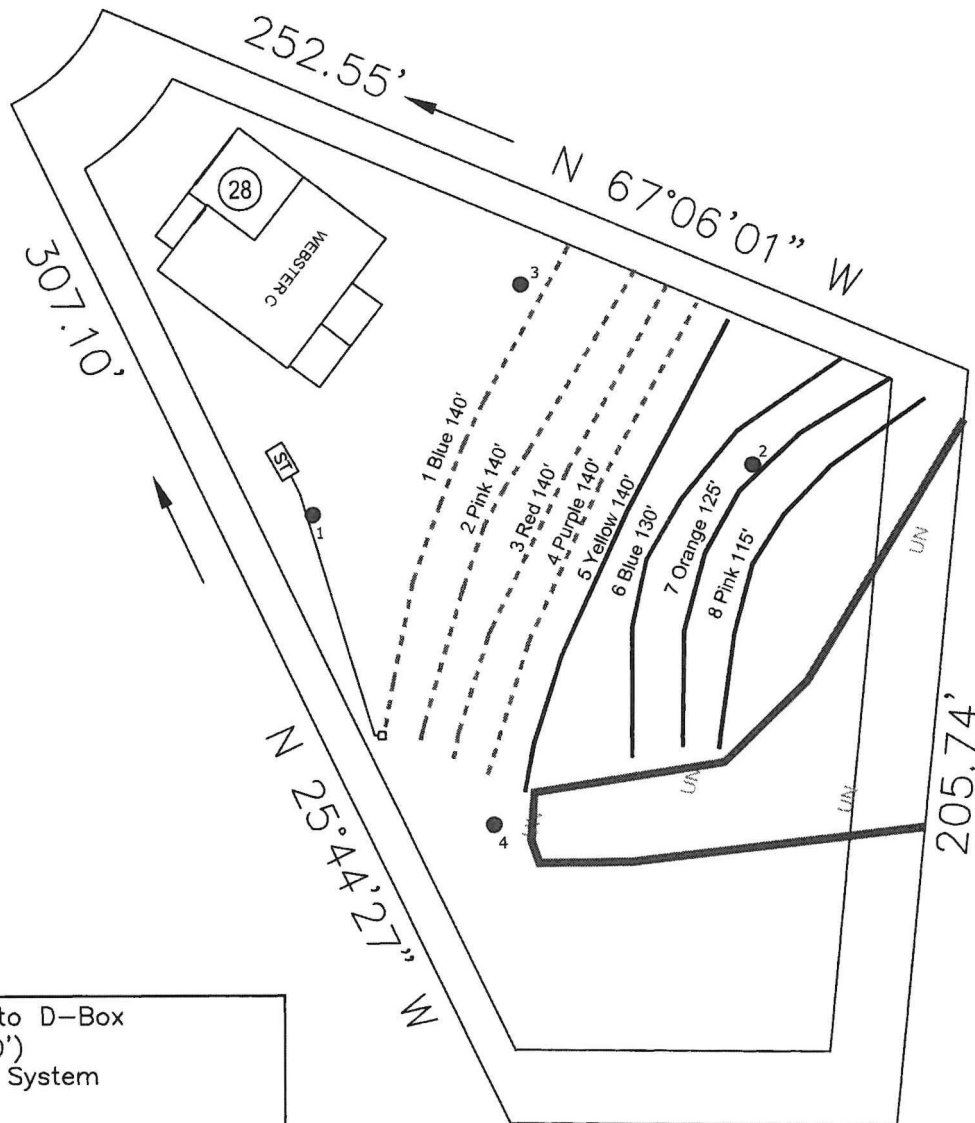

System: Gravity to D-Box
 Lines: 1-4, (560')
 Accepted Status System
 0.3 Soil LTAR
 24" Trench Bottom

Repair: Gravity to Serial Dist.
 Lines: 5-8, (510')
 Accepted Status System
 0.3 Soil LTAR
 24" Trench Bottom

GRAPHIC SCALE
 1" = 50'

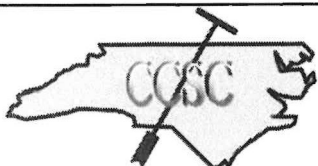

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

5-Bedroom Septic Layout
 Lot 29, Maison Ridge Subdivision
 Franklin County, North Carolina

Job#: 4862
 Drawn By: MS
 Date: 08/26/2024
 Revision: