


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.

System: _____
Repair: _____

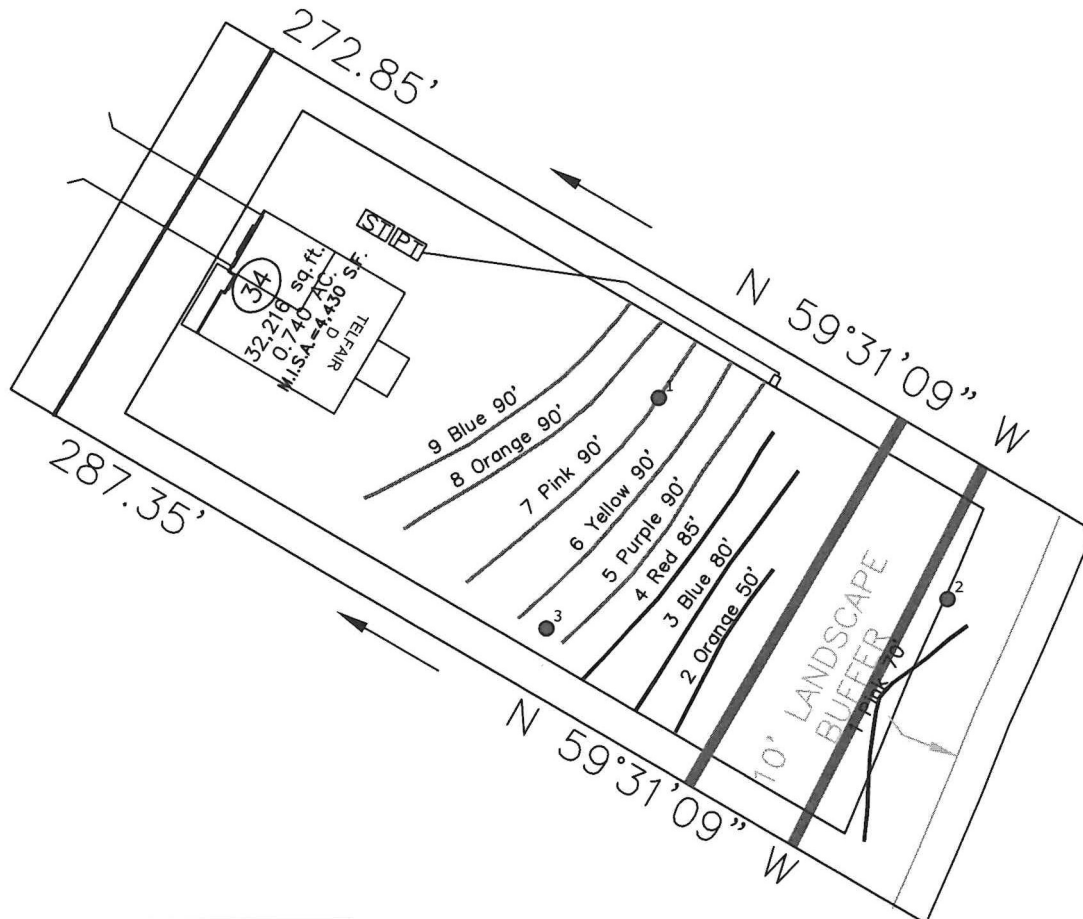

System: Pressure Manifold
Lines: 5-9, (450')
Accepted Status System
0.3 Soil LTAR
24" Trench Bottom

Repair: Pressure Manifold
Lines: 1-4, (285')
T&J Panel 50% Reduction
0.3 Soil LTAR
24" Trench Bottom

GRAPHIC SCALE
1" = 50'



Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
Lot 34, Mt. Olivet Subdivision
Franklin County, North Carolina

Job# : 4703
Drawn By : AH
Date : 9/20/2024
Revision: