


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.


System: 
 Repair: 
 Boring: 
 ST : 1000 Gallon
 PT : 1200 Gallon

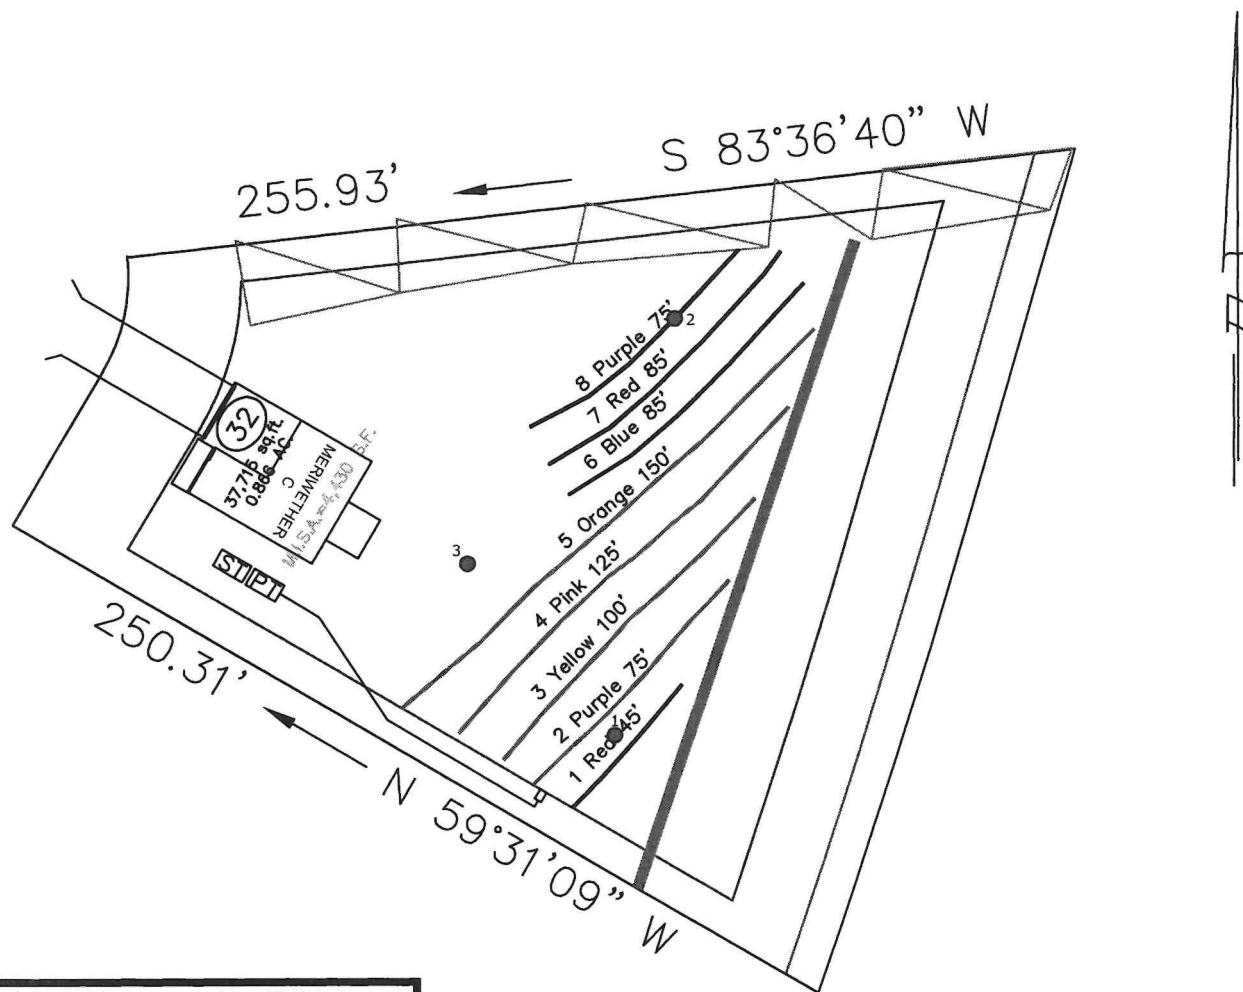

System: Pressure Manifold
 Lines: 2-5, (450')
 Accepted Status System
 0.3 Soil LTAR
 22" Trench Bottom

Repair: Pressure Manifold
 Lines: 1,6-8, (290')
 T&J Panel 50% Reduction
 0.3 Soil LTAR
 22" Trench Bottom

GRAPHIC SCALE
 1" = 50'

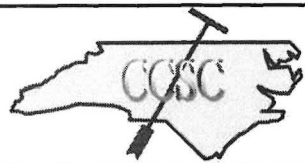

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 32, Mt. Olivet Subdivision
 Franklin County, North Carolina

Job# : 4703
 Drawn By : AH
 Date : 9/22/2024
 Revision: