


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.

System:	
Repair:	
Boring:	
ST:	1000 Gallon
PT:	1200 Gallon

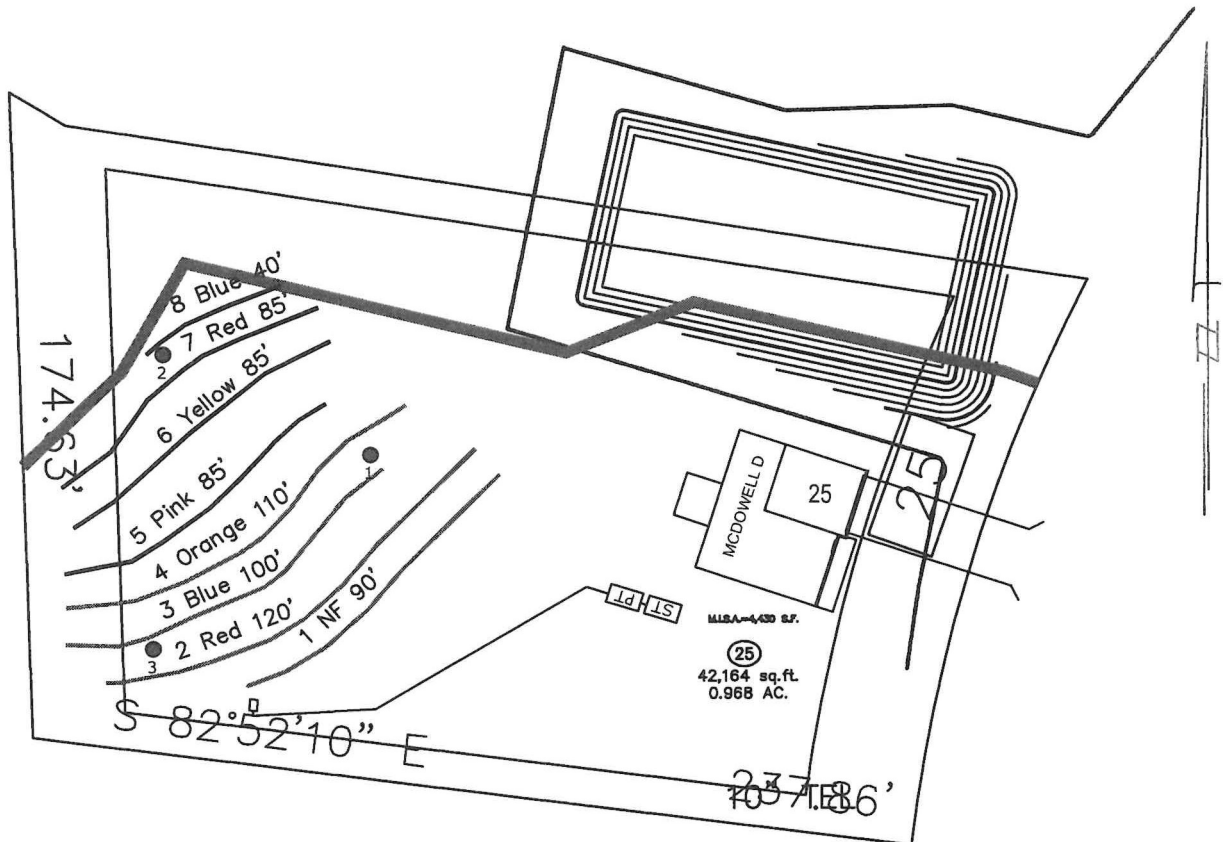

System: Pressure Manifold
 Lines: 1-4, (415')
 Accepted Status System
 0.30 Soil LTAR
 22" Trench Bottom

Repair: Pressure Manifold
 Lines: 5-8, (295')
 T&J Panel 50% Reduction
 0.30 Soil LTAR
 18" Trench Bottom

GRAPHIC SCALE
 1" = 50'



Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 25, Olivet Subdivision
 Franklin County, North Carolina

Job# : 4703
 Drawn By : AH & MS
 Date : 10/25/2024
 Revision: