





- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

GRAPHIC SCALE
1" = 50'

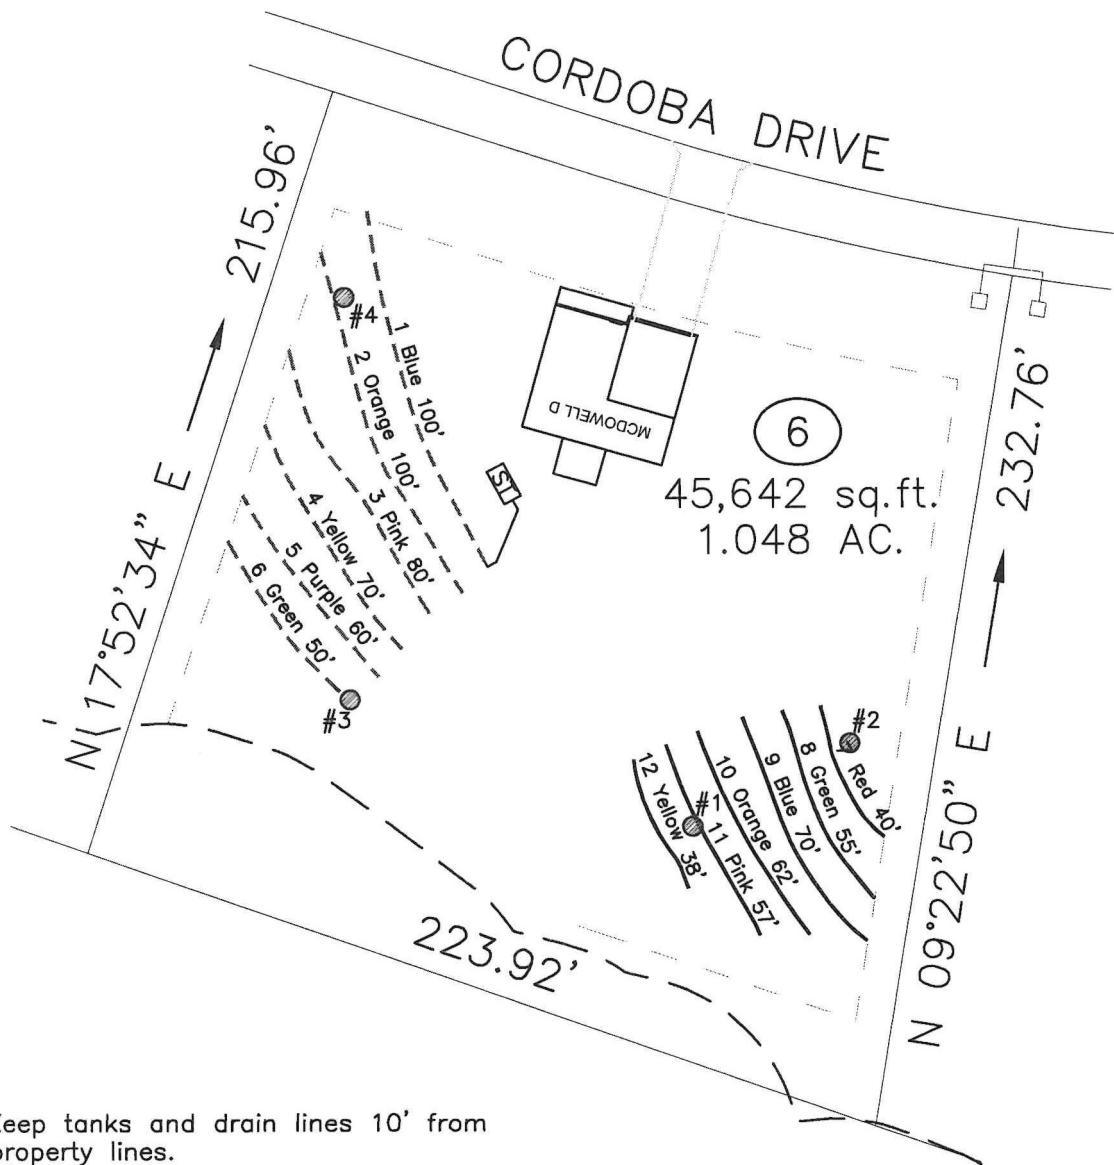

System:	-----
Repair:	-----
ST	= 1000 gallon tank with risers
#2	= profile description locations

Initial System: Gravity to Serial Lines: 1-6, (460')
Accepted Status System (25% reduction) 0.3 Soil LTAR 24" Trench Bottom on the downhill side
Repair System: Pressure Manifold Lines: 7-12, (322')
T&J Panel Block System (vertical) 0.3 Soil LTAR 32" Trench Bottom on the downhill side

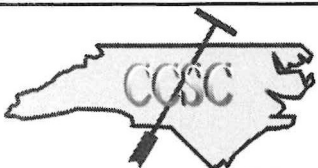

Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
Lot 6, Olivet Subdivision
Franklin County, North Carolina

Job#: 4703
Drawn By: JR
Date: 01/02/2025
Revision: