


- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

System: - - - - -
 Repair: —————
 [ST] = 1000 gallon tank with risers
 #2 = profile description locations




GRAPHIC SCALE
 1" = 50'

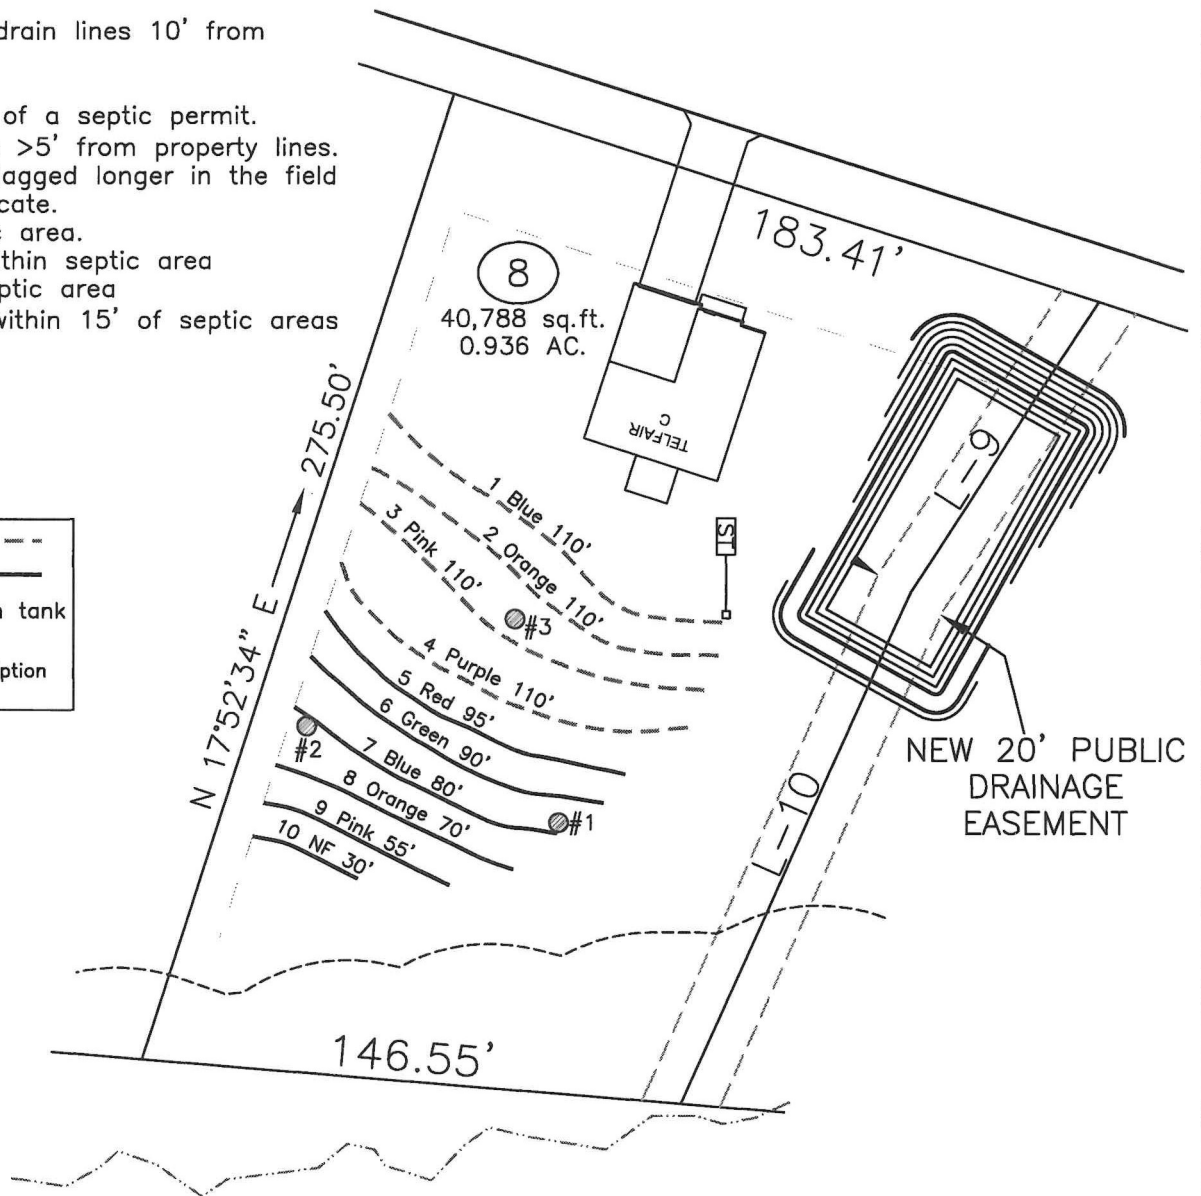

Initial System: Gravity to D-Box
 Lines: 1-4, (440')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 18" Trench Bottom on the downhill side

Repair System: Gravity to Serial Dist.
 Lines: 5-10, (420')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 18" Trench Bottom on the downhill side

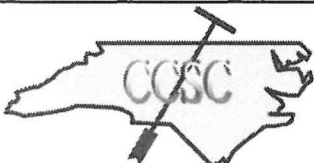

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 8, Olivet Subdivision
 Franklin County, North Carolina

Job#: 4703
 Drawn By: JR
 Date: 01/23/2025
 Revision: