


Initial System: Gravity to Serial
 Lines: 2-6, (534')
 Quick4 Plus Low Profile Chambers System
 Quick4 Plus All-in-One 8 Endcaps (10)
 0.3 Soil LTAR
 11" Trench Bottom on the downhill side
 5" of additional cover material needed

Repair System: Gravity to Serial Dist.
 Lines: 1, 7-10, (445')
 Accepted Status System (25% reduction)
 0.3 Soil LTAR
 13" Trench Bottom on the downhill side
 7" of additional cover material needed


System: 
 Repair: 
 = 1000 gallon tank with risers
 = profile description locations

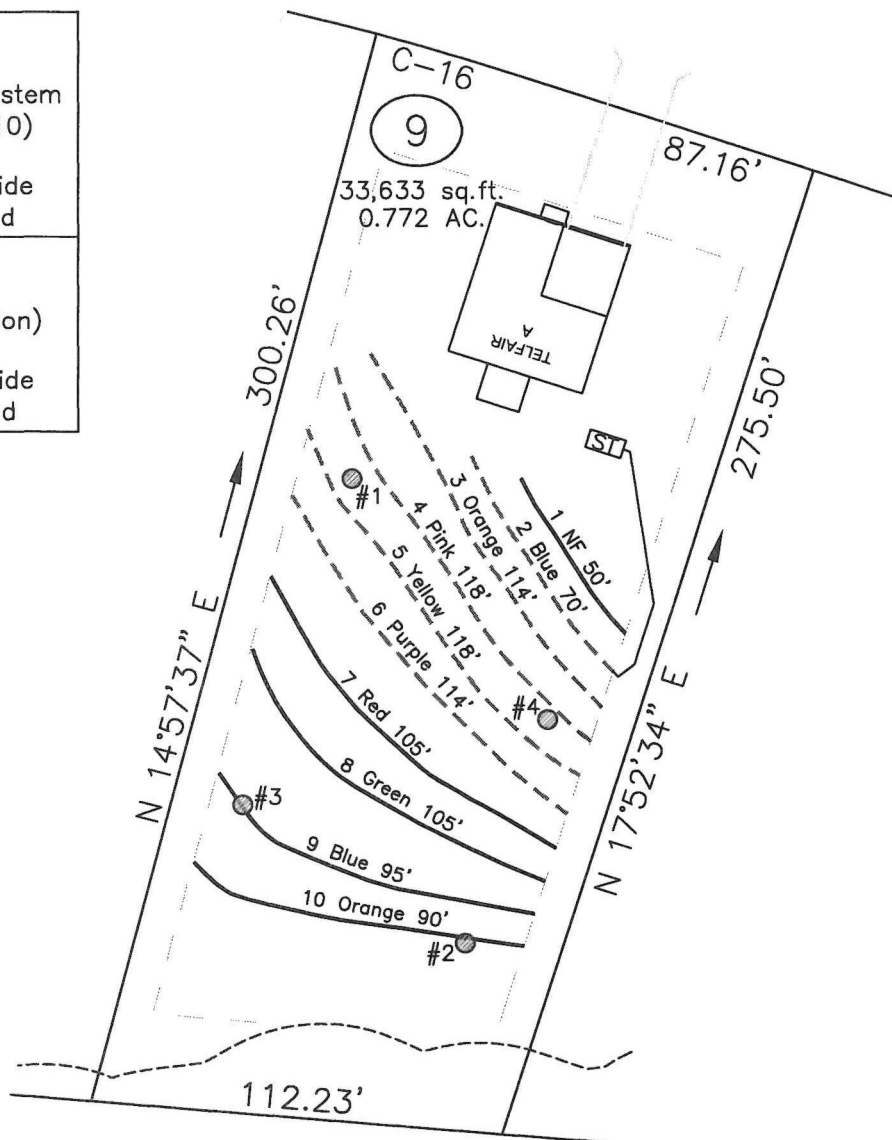

GRAPHIC SCALE
 1" = 50'



- *Keep tanks and drain lines 10' from property lines.
- *Not a survey.
- *Not a guarantee of a septic permit.
- *Keep supply lines >5' from property lines.
- *Some lines are flagged longer in the field than lengths indicate.
- *No grading septic area.
- *No adding soil within septic area
- *No rutting-up septic area
- *No cuts of >2' within 15' of septic areas

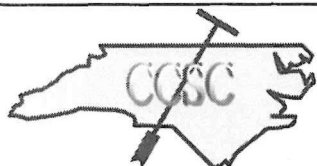

Central Carolina Soil Consulting, PLLC
 1900 South Main Street, Suite 110
 Wake Forest, North Carolina 27587
 Phone (919)569-6704 Fax (919)569-6703

4-Bedroom Septic Layout
 Lot 9, Olivet Subdivision
 Franklin County, North Carolina

Job#: 4703
 Drawn By: JR
 Date: 01/24/2025
 Revision: